

APPENDIX C

Soil Logs & Well Construction Diagrams

- C-1: Geoprobe Soil Logs
- C-2: Cone Penetrometer Testing (CPT) Soil Logs
- C-3: Subsurface Drilling Soil Logs & Well Construction Diagrams
- C-4: Test Pit Logs – OU 1

Soil Boring Log

Boring No:
 2-MW-19A

Boring Location info:

Project: FUSRAP DUPONT GW P4.2		Proj. No. 3404.00
date: 8-23-05		page: 1
time: 0830		of: 1
By: CMY		
water depth / time:		water depth / time:
drilling method: HAND AUGER diam: 4 IN		surface conditions: SOIL
start/finish: 0820 / 0930		elevation:

depth (show units)	Soil Texture	Well Construction	sample depth	sample. no.	% recovery	OVA (ppm)	FIDLER Scan	Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.
1		2" SCH 40						SAND, SILTY, CLAYEY, BLACK WITH RUBBLE
2								
3								
4								
5								
6								
7								



CABRERA SERVICES
INDUSTRIAL, ENVIRONMENTAL, REMEDIATION
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

Boring Location info:

4W-20 (A)

F-Corral

DuPont

Project:

DuPont

Proj. No.

date: 7/18/05

page: 1

time: 0700

of: 1

By: MPhillips

water depth / time:

water depth / time:

drilling method: sonic

surface conditions:

diam: 8"

gravel

start/finish: 0700/1000

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	Soil Texture	Well Construction	sample depth	sample. no.	% recovery	OVA (ppm)	FIDLER Scan	Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.
0			1.0			0.0		0-0.3' gravel
			1.5					0.3-1.5' gravel (crushed stone) mixed with dk yellow-brown (10YR 4/4) clayey silt, moist
			0900					1.5-2.3' concrete foundation / slab
2	ML		2.0			15.2		2.3-3.0' black (10YR 2/1) stained clayey silt w/ some fine sand, moist, includes coal slag/wood ash
			2.5			24.7		3.0-6.4' brown (10YR 4/3) silty fine sand with some clay, moist (saturated at 5.0')
	SM		0900					
4						28.7		
						24.2		
6	ML					21.0		6.4-7.5' gray (5Y 5/1) sandy silt w/ little clay, wet, dense
						21.4		7.5-8.6' gray (5Y 5/1) silty clay, moist, stiff
	CL							8.6-9.0' no recovery
8						5.2		EOB 9.0' well set to 7.5' bgs screened 5.0-7.5'; sand to 4.5'; bentonite to 3.5'



CABRERA SERVICES
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

MW-21

Boring Location info:

MW-21 (A)
F-Corral
DuPont

Project:

DuPont

Proj. No.

date: 7/14/05

page: 1

time: 1250

of: 2

By: M Phillips

water depth / time:

water depth / time:

drilling method: sonic

surface conditions:

diam: 8"

asphalt paving

start/finish: 1250/1730

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	Soil Texture	Well Construction	sample depth	sample. no.	% recovery	OVA (ppm)	FIDLER Scan	Description
0-0.5'								asphalt
0.5-1.0'								gravel/asphalt mix
1.0-2.5'								mixed asphalt and possible gravel from previous investigation?
2.5-4.0'								no recovery
4-5.3'	SM		4.3				19	dark gray-brown (10YR 4/3), clayey fine sand with silt, moist, medium stiff
5.3-7.0'	SW		6.0				66	dark gray-brown (10YR 4/3) well-graded sand with subrounded gravel up to 80mm, wet
7.0-7.6'	ML		7.0					dk brown (10YR 3/3) silty clay w/ some sand (fine), moist, stiff
7.6-8.5'	SW		8.0				133	dk yellow-brown (10YR 4/6) well-graded sand, subrounded, up to 32mm gravel
8.5-9.0'								no recovery
9-11.5'								slop from previous intervals



CABRERA SERVICES
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

MW-21

Boring Location info:

MW-21 (A)

F-Corral

DuPont

Project:

DuPont

Proj. No.

date: 7/14/05

page: 2

time: 1050

of: 2

By: M.A. Phillips

water depth / time:

water depth / time:

drilling method: Sonic

surface conditions:

diam: 8"

start/finish: 1050 / 1730

elevation:

depth (show units)

Soil Texture

Well Construction

sample depth

sample no.

% recovery

OVA (ppm)

FIDLER Scan

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.



SW

Q7

11.5-12.7 dk gray-brown (10 YR 4/3) well-graded sand, subrounded, up to 5mm, with silt; wet

12.7-14' no recovery

EOB 14' bgs 4" sch 40 PVC well well set to 9' bgs, 2.5' screen (10-slot) screen interval 6.5-9'. W sand to 6'; bentonite chips to 5'; 20:1 cement; bentonite grout to surface



CABRERA SERVICES
PROFESSIONAL • ENVIRONMENTAL • CONSULTING
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

Boring Location info:

MW-22 (A)

F-Coral

DuPont

Project:

DuPont

Proj. No.

date: 7/16/05

page: /

time: 0800

of: 1

By: M.A. Phillips

water depth / time:

water depth / time:

drilling method: sonic

surface conditions:

diam: 8"

gravel/asphalt

start/finish: 1300/0800
7/16/05

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth - FIDLER (show units)	Soil Texture	Well Construction	sample depth	sample. no.	% recovery	OVA (ppm)	FIDLER Scan	Description
0-0.7'						18.0		0-0.7' asphalt and gravel
0.7-1.1'						160		0.7-1.1' gravel sub-base
1.1-2.5'	SW							1.1-2.5' gray (5Y 6/1) well-graded gravelly sand, subrounded gravel up to 35mm, moist
2.5-3.0'	CL							2.5-3.0' (5Y 3/1) dk. clay gray silty clay w/ some sand, very stiff, moist
3.0-3.6'			3.0-3.5'			2768		3.0-3.6' black (5Y 2.5/1) charcoal/burnt material, slightly moist, very loose
3.6-3.9'	CL		0.100			231		3.6-3.9' brown (10YR 4/3) silty clay, moist, very stiff
3.9-7.0'	SP					3287		3.9-7.0' dk brown (10YR 3/3) fine sand with silt saturated, loose, fines to a silty sand w/ some clay @ 7.0'
7.0-9.0'	SM ML		6.0-6.5'			74.9		7.0-9.0' gray + orange mottled silty clay, medium stiff, moist, mica throughout
9.0-10.0'			0.110			1829		9.0-10.0' gray + orange mottled silty clay, medium stiff, moist, mica throughout

EOB 9.0' bgs
 screened 4.5-7.0' bgs; sand to 4.0';
 bentonite to 3.0'; grout to surf.



CABRERA SERVICES

GEOLOGICAL - ENVIRONMENTAL - INVESTIGATION
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

Boring Location info:

UW-23 (B)

F-Corral

DuPont

Project:

DuPont

Proj. No.

date: 7/18/05

page: 1

time: 1100

of: 2

By: M Phillips

water depth / time:

water depth / time:

drilling method: sonic

surface conditions:

diam: 8"

gravel

start/finish: 1100 / 1600

elevation:

depth (show units)	Soil Texture	Well Construction	sample depth	sample no.	% recovery	OVA (ppm)	FIDLER Scan	Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.
2	SM		2.0 2.5 1337			0.7		0-0.5' gravel
						1.7		0.5-1.0' gravel mixed with brown (10YR 5/3) silty clay
4						1.4		1.0-2.6' mix of gravel, coal slag, wood debris trash, moist
	ML					1.1		2.6-5.0' olive gray (5Y 5/2) silty fine sand, dense, saturated
6						1.9		5.0-6.5' olive gray (5Y 5/2) sandy silt with clay, wet, medium stiff
								6.5-9.0' no recovery
8	CH					0.0		9.0-10.4' olive gray (5YR 5/2) silty clay, moist, highly plastic, medium stiff



CABRERA SERVICES
 GEOLOGICAL - ENVIRONMENTAL - REMEDIATION
 WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

Boring Location info:

MW-23 (B)
 F-Corral
 DuPont

Project:

DuPont

Proj. No.

date: 7/18/05

page: 2

time: 1100

of: 2

By: M. Phillips

water depth / time:

water depth / time:

drilling method: sonic

surface conditions:

diam: 8"

gravel

start/finish: 1100 / 1600

elevation:

depth (show units)	Soil Texture	Well Construction	sample depth	sample. no.	% recovery	OVA (ppm)	FIDLER Scan	Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.
10.5-11.0	ML		1335			898		10.4-10.8' blue (5YR 4/4) clayey silt with some sand, moist, slightly plastic, soft
12 SW						80.7		10.9-16.5' brown (10YR 4/3) well-graded sand with silt, gravel (subrounded) up to 17mm, saturated, dense
14						16.5		
16	SP					12.7		16.5-17.2' brown (10YR 4/3) medium sand, dense, saturated
18	SW					0.9		17.2-18.0' brown (10YR 4/3) well-graded gravelly sand with silt, subrounded gravel up to 28mm
								EOS 18' logs - screen set 8-18' sand to 7.5' bentonite to 6.5', grout to surf.



CABRERA SERVICES
GEOLOGICAL - ENVIRONMENTAL - REMEDIATION
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

Boring Location info:

MW-24 (A)
F-Corral
DuPont

Project:

DuPont

Proj. No.

date: 7/17/05

page: 1

time: 0730

of: 1

By:

M. Phillips

water depth / time:

water depth / time:

drilling method: Sonic

diam: 8"

start/finish: 0730 / 1200

surface conditions:

asphalt paving

elevation:

depth - ft logs (show units)	Soil Texture	Well Construction	sample depth	sample. no.	% recovery	OVA (ppm)	FIDLER Scan	Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.
0								0-0.7' asphalt paving
								0.7-1.5' gravel sb-base
2	SM		2.0 2.5 0920					1.5-2.5' olive gray (SY 4/2) silty, fine to medium sand with some large (up to 4/2mm) subrounded gravel; medium dense, moist
4								2.5-5.8' concrete rubble, moist at 2.5-4.6'; saturated 4.6-5.8'
6	OH SM		6.0 6.5 0925					5.8-6.0' black (10 YR 2/1) organic marsh sediment, plastic, wet
8	ML							6.0-8.5' brown (10 YR 4/3) silty sand with clay, very fine sand, grades to a clayey silt with fine sand at 8.5'
								8.5-9.0' no recovery
								EOB 9.0' logs Well set to 8.0' logs, screened 5.5-8.0', sand to 5.0', bentonite to 4.0' logs

Soil Boring Log

Boring No:

MW-25-C

Boring Location info:

GROUNDWATER
OUT, AOI, AOC

Project:

OUT Phase 2

Proj. No.

date:
time:

11/18/05

page:

of:

1

4

by: J. Von Lidenitz

water depth / time:

5-57

water depth / time:

drilling method: Zota sonic

GP 24-300RS

diam: 4-inch

start/finish:

surface conditions:

Asphalt

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	soil texture	Sample well Recovery construction	sample depth	sample. no.	OVA (ppm)	FIDLER Scan	
1		5/5			17.6	4762	0-1.5 Asphalt + Subbase
						4567	1.5-3.5 white + Black Coarse sand + Cobble
					88.1	4725	dry.
2						5725	3-4 Large Rock - appears to be concrete
					95.6	7633	
3						7520	3.5-5 white Coarse sand w/ Rocks
						8115	
4					179	4753	
						4470	
5		5/5	5'		243	4585	5-8 Brown (Petroleum Saturated - Black rocks)
			6'		491	20313	F-Sed w/ some silt. Loose, non-cohesive
6						25633	+ G-2 some light gray mottled F-sed + silt.
					441	16926	8-9.5 Light Gray/Brown mottled silt clay
7						11770	w/ some sand. Tight, cohesive, plastic
					1003	12259	
8						10160	9.5-11 Rich Gravel + coarse sand.
					2135	10832	Saturated w/ heavy sheen
9						16546	
					4757	9998	
10						7308	

Background FIDLER: 4478

Soil Boring Log

Boring No

MW-25-C

Boring Location info:

Project:

Proj. No.

OU# Phase 2

date: 11/13/05

page: 2

time:

of: 4

by: J. Van Lidenitz

water depth / time:

water depth / time:

drilling method: Rotasonic
6P 24-300RS

surface conditions:

diam: 4-inch

start/finish:

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	soil texture	Sample with Recovery construction	sample depth	sample no.	OVA (ppm)	FIDLER Scan
10		5/5		881	6342	
11				203	5724	
12				339	5925	
13				205	5490	
14				291	4826	
15		* 5/5				
16						
17						
18			18		5637	
19			19	238	5220	
20				211	5061	
					4880	

9-5-19 River Canal & coarse sand

* Some of Sample (3-4) was lost in a drum or liquid.

A-20 Dark Grey Silty Clay. Tight Plastic w/ some unf-sand.

Soil Boring Log

Boring No:

MW-25C

Boring Location info:

Out, ^{Groundwater} AOI, AOC

Project:

Out Phase 2

Proj. No.

date: 11/14/05

page: 3

time:

of: 4

by: J. Von Uderitz

water depth / time:

water depth / time:

drilling method: Zota sonic

GP 24-300RS

diam: 4-inch

surface conditions:

start/finish:

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	soil texture	Sample well Recovery construction	sample depth	sample. no.	OVA (ppm)	FIDLER Scan
21		5/5			26.1	5247
						5403
22					15.3	5620
						5752
23					8.0	5768
						5974
24					4.1	6017
						5963
25			24		0.0	5812
			25			5777
26		5/5			3.5	5545
						5832
27					10.6	5838
						5643
28					3.0	5512
						5461
29					10.1	5464
						5516
30					18.4	5513
						5513

20-24 Dark Grey silty clay. Very tight
 plastic. Trace white to silver mica

(24.5-1" Layer. M-L sand - Dark Grey in some
 small conical

~~24.24-31~~ 27.24-31, Bluish Grey

Very L sand + clay. Tight, cohesive
 trace small conical

Background FIDLER Data 2-4639



CABRERA SERVICES
RADIOLOGICAL - ENVIRONMENTAL - REMEDIATION
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

MW-25-C

Boring Location info:

Groundwater
OU 1, AOI, AOC

Project:

OU Phase 2

Proj. No.

date: 11/14/03

page: 4

time:

of: 24

by: J. Von Uderitz

water depth / time:

water depth / time:

drilling method: Rotasonic
GP 24-300RS
diam: 4-inch
start/finish:

surface conditions:

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	soil texture	Sample Well Recovery Construction	sample depth	sample. no.	OVA (ppm)	FIDLER Scan
31		5/5			2.2	5403
32			31			5198
33			32		2.1	5336
34						5352
35					4.4	5504
36						5678
37					4.9	5887
38						5840
39					2.0	5620
40						5259

31-32.5 Light Gray Coarse Sand w/ silt
w/ some River Gravel, & larger stones

32.5-35

Blue gray silty clay w/ very f. sand
tight, plastic.

TD: 35.Ft

Well Construction MW-25-C

Riser 0-29.5

Screen 29.5-34.5 0.61"

Sand 28-35 II 00 N

Bentonite 26-28 3/4 bag mixed +
Purplex down

Grout 1-26

Drilled out 4" borehole w/ 8" Borehole





CABRERA SERVICES
GEOLOGICAL • ENVIRONMENTAL • REMEDIATION
 WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

Boring Location info:

NW-26 (A)
 F-Coral
 DuPont

Project:

DuPont

Proj. No.

date: 7/17/05

page: 1

time: 1230

of: 2

By: M Phillips

water depth / time:

water depth / time:

drilling method: Sonic

surface conditions:

diam: 8"

asphalt paving

start/finish: 1230/1600

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	Soil Texture	Well Construction	sample depth	sample. no.	% recovery	OVA (ppm)	FIDLER Scan
0							
2	SW		1.5'				
			2.0'				
			1400				
4							
6							
8							

0-0.8' asphalt
 0.8-1.2' crushed asphalt and gravel
 1.2-2.2' yellow-brown (10YR 5/8) well-graded sand, subrounded, up to 12 mm, moist
 2.2-7.0' loose concrete and wood waste (no recovery 4.5-6.2' bgs); dry

6.2-8.5' solid concrete foundation material; dry

8.5-9.0' no recovery, unconsolidated materials



CABRERA SERVICES
RADIOLOGICAL - ENVIRONMENTAL - REMEDIATION
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

Boring Location info:

MW-26 (A)
 F-Corral
 Dupont

Project:

DuPont

Proj. No.

date: 7/17/05

page: 2

time: 1230

of: 2

By: M. Phillips

water depth / time:

water depth / time:

drilling method: sonic

surface conditions:

diam: 8"

asphalt

start/finish: 1230 / 1600

elevation:

depth (show units)	Soil Texture	Well Construction	sample depth	sample no.	% recovery	OVA (ppm)	FIDLER Scan
-----------------------	--------------	----------------------	--------------	------------	------------	-----------	-------------

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

10	OL		9.5-9.5 1410					9.0-11.0' silty marsh sediments with some debris including concrete, metal, gravel brick; black (10 YR 2/1), saturated
12	SW							11.0-12.0' olive (5Y 5/3) sand/gravel mix; subrounded gravel up to 19mm; saturated (B aquifer material)
14								EOB 12.0' bgs
16								well screened 6.5-8.0' sand to 5.5' bent. chips to 4.5'



Soil Boring Log

Boring No:

4-MW-010

Boring Location info:
AOC 4 SWMU 5
Near water
Marsh

Project: Supplementary Investigation 04-3406.00
date: 5-8-06 page: 1
time: of: 2

By: Ken Marion

water depth / time: water depth / time:

drilling method: Rotacore
GP24-300RS
diam: 4-inch core
5 ft, long
start/finish: 0855-1000
surface conditions: Marsh
elevation:

depth ft (show units)	Soil Texture	Well Construction	sample depth	sample no.	% recovery	PILO GVA (ppm)	FIDLER Scan	Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.
0					80	0	3761	Very dark grayish brown silty CLAY (CL) with root matter, very moist, low plasticity, soft
1						0	3847	Reddish yellow fine sandy CLAY (CL), moist
						0	3736	mod low plasticity, stiff
2						0	3668	Dark gray medium SAND (SP) with a little
						0	3756	quartz gravel, moist, medium dense
						0	3873	
3						0	3619	
						0	3670	
4						0	3648	Light gray medium to coarse sand (SP) with
						NA	NA	trace brown glass, a little quartz gravel, medium dense, moist, fill
5						NA	NA	No Recovery
					90	0	3855	Dark gray SAND (SW) with a little gravel,
6						0	3671	trace glass and wire fragments, trace
						0	3593	brick fragments, fill, wet, medium dense
7						0	3856	
						0	3846	
						0	3831	
8						0	3652	Very dark gray sandy CLAY (CL) with
						0	3960	organic matter, very moist, medium stiff,
9						0	3731	low plasticity
						0	3832	
10						NA	NA	No Recovery

Background = 3814 cpm
FUSRAP DuPont GW SI 3816
4035
3999

NA = Not Applicable



Soil Boring Log

Boring No:

4-MW-01

Boring Location info:

AOC 4 SWMU 5
Near Water
Marsh

Project: DuPont

Proj. No.

Supplementary Investigation 04-3406.00

date: 5-8-06

page: 2

time:

of: 2

By: Ken Marion

water depth / time:

water depth / time:

drilling method: Rotasonic
GP24-300RS
diam: 4-inch core
5 ft long
start/finish: 0855-1000

surface conditions:
Marsh
elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	Soil Texture	Well Construction	sample depth	sample no.	% recovery	R.D.	QVA (ppm)	FIDLER Scan	
10								3928	Dark gray sandy CLAY (CL) with organic matter, very moist, low plasticity, soft
11					70	0.1		3719	
								3974	
12						0.1		4312	Olive gray silty sandy CLAY (CL) with a little reddish yellow mottling, trace gravel, wet, low plasticity, soft
								4385	
						0.1		4435	
13								4465	
						0.1		4484	
14								NA NA	No Recovery
								NA NA	
15								NA NA	
								4028	Yellow brown SAND (SC) with trace gravel, trace reddish brown mottling, medium dense, wet
16					70	0.1		3872	
								4280	
						0.1		4155	
17								4431	
				X		0		5181	Gray CLAY (CL) with trace silt sand and gravel, moist, very stiff, medium plasticity
18				X		0		5147	
								4629	
19								NA NA	No Recovery
								NA NA	
20								NA NA	

Bottom of Borehole at 20 ft



CABRERA SERVICES
RADIOLOGICAL - ENVIRONMENTAL - REMEDIATION
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

4 MW-02

Boring Location info:

AOC4 SWMU 5
Marsh
Near Water

Project: DUPONT
SUPPLEMENTAL
INVESTIGATION

Proj. No.
04-3406.00

date: 5/8/06
time: 1415

page: 1
of: 1

By: K. MARION
D. KATELOV M. DRISCOLL

water depth / time:

water depth / time:

drilling method:

surface conditions:

diam: 4-inch core
5 ft. long

Marsh

start/finish: 1415-1445

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	Soil Texture	Well Construction	sample depth	sample no.	% recovery	PID GVA (ppm)	FIDLER Scan	
1					100	0	3753	DARK BROWN CLAYEY SILT (ML), ORGANIC MATTER, MOIST, VERY LOOSE
						0	3722	REDDISH YELLOW CLAYEY FINE SAND (SC)
						0	3762	TRACE GRAVEL, MOIST, MEDIUM DENSE
2						0	3885	
						0	3874	
3						0	3700	DARK GRAY MEDIUM SAND (SP) WITH LITTLE GRAVEL, MOIST, MEDIUM DENSE BECOMING LIGHTER IN COLOR TOWARDS END
						0	3725	
						0	3499	
						0	3617	
						0	3597	
5					100	0	3630	
						0	3749	GRAYISH BROWN MEDIUM TO COARSE TRACE REDDISH BROWN MOTTLED SAND (SP) VERY MOIST, FINE TO COARSE GRAVEL
6						0.1	3730	
						0.1	3615	
						0.1	3602	
7						0.1	3725	
						0.1	3647	
8						0.1	3610	OLIVE GRAY FINE TO MEDIUM SAND (SP) W/ TRACE GRAVEL, BLACK SLAG. FILL
						0.1	3697	
9						0.1	3760	VERY MOIST, DENSE
						0.1	3967	VERY DARK GRAY W/ SOME SILT (CL), ORGANIC MATTER, MEDIUM STIFF
10						0.1	3996	

Bottom of borehole at 10 ft



Soil Boring Log

Boring No:

4-MW-05

Boring Location info:

AOC4 SWMU 5

MARSH

NEAR WATER

Project: DUPONT
SUPPLEMENTAL
INCL

Proj. No.

04-3406-00

date: 5-8-06

page: 1

time:

of: 1

D. KATELEY

By: K. MARION M. DRISCOLL

water depth / time:

water depth / time:

drilling method: ROTASONIC

surface conditions:

diam: 4" CORE
5' FT LONG


MARSH

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

ft depth (show units)	Soil Texture	Well Construction	sample depth	sample. no.	% recovery	PFD PPM (ppm)	FIDLER Scan
0							3947 DARK BROWN CLAYEY SILT (ML)
1						60 0.4	3915 W/ ORGANIC MATTER, MOIST, LOOSE
2						0.3	3963 REDDISH YELLOW CLAYEY FINE SAND (SC) MOIST
3						0.3	4025 GRAYISH BROWN GRAUVEY SAND (SP) WOOD CHIPS, MOIST, MEDIUM DENSE
4						0.3	4074 OLIVE GRAY SILTY SANDY CLAY (CL) BRN + ORGANIC MATTER, MOIST W/ MED PLASTICITY
5							NO RECOVERY
6						100 0.1	4133 BLACK SAND WITH LITTLE CLAY (SC), SOME ORGANIC MATTER, TRACE METAL AND CERMIC
7							4041 4078 3998
8							4053 VERY DARK CLAY (CL) WITH ORGANIC MATTER MEDIUM STIFF, MOIST
9							3925 3790 3920
10							3765

BACKGROUND 4121 CPM
3870 CPM



CABRERA SERVICES
RADIOLOGICAL - ENVIRONMENTAL - REMEDIATION
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

4 MW-06

Boring Location info:

GRAVEL PARKING LOT
IN AOC 4, SWMU 5

Project: DUPONT
SUPPLEMENTAL
INVESTIGATION

Proj. No.

04-3406.00

date: 5/9/06

page: 1

time: 0740

of: 1

By: C. YOUNG
D. KATELEY

water depth / time:

water depth / time:

drilling method: ROTOSONIC

surface conditions:

diam: 4 IN CORE
5 FT LONG

GRAVEL LOT

start/finish:
0745 / 0905

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	Soil Texture	Well Construction	sample depth	sample. no.	% recovery	P/O (ppm)	FIDLER Scan
1	GRAVEL				100	0.6	4411
2						0.7	4192
3						5.3	4660
4							
5							
6	GRAVEL				50	0.1	4407
7	GRAVEL					6.2	4705
8	GRAVEL					0.3	5015
9	GRAVEL						6185
10	GRAVEL						6075
							8537
							10100

SAND GRAVELY (SW) TAN GRADING TO
BLACK. FILL

NO RECOVERY

PURPLE BLACK GRAVEL, VERY
WET, STRONG ODOR. (GW)

BACKGROUND 4394 CPM
4387



CABRERA SERVICES
BIOLOGICAL - ENVIRONMENTAL - REMEDIATION
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

4-MW-07

Boring Location info:

AOC 4 SWMS

Near water

Marsh

Next to 4-MW-01

Project: DuPont

Proj. No.

Supplementary Investigation 04-3406-00

date: 5-8-06

page: 1

time:

of: 1

By: Ken Marion, Dave Kateley

M. DRISCOLL

water depth / time:

water depth / time:

drilling method: Rotasonic
GP24 - 300 RS
diam: 4-inch core
5 ft long
start/finish: 1230-1300

surface conditions:
Marsh

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	Soil Texture	Well Construction	sample depth	sample no.	% recovery	R.D. GPA (ppm)	FIDLER Scan	Description
0								
1					75	0.2	3927	Dark grayish brown, silty CLAY (CL)
							3833	with root matter, moist, low plasticity, soft
						0.1	3870	Reddish yellow clayey fine sand (SC)
								with a little gravel, moist, medium dense
2							3746	FILL
							3597	Dark gray gravelly sand (SP) with
						0.2	3692	trace brick fragments, moist,
3							3630	medium dense, FILL
4							NA	
						0	NA	NO RECOVERY
5					100	0	3624	
							3470	DARK GRAY GRAVELLY SAND (SP) WITH
							3264	NO BRICK, FINE GRAVEL, WET, FILL
6						0	3408	MEDIUM DENSE.
							3530	
						0	3487	
7							3531	
							3947	VERY DARK GRAY CLAY w/ ORGANIC
8						0	3803	MATTER, MEDIUM PLASTICITY,
							3794	MEDIUM STIFF
9						0	3621	
							3542	
10						0	3685	

BACKGROUND RDG. 3926 CPM / Bottom of Borehole at 10 ft

Soil Boring Log

Boring No:

~~10MW9~~ 6mw01

Boring Location info:

Project:

Proj. No.

003 phase 2

date: 11/29/05

page: 1

time: 800

of: 2

by: Joe Van Uderitz

water depth / time:

9-Ft

water depth / time:

drilling method: Rotasonic

diam: 4" / 12"

surface conditions:

Asphalt

start/finish:

elevation:

AOI-4
AOC-6

depth (show units)	soil texture	Recovery well construction	sample depth	sample. no.	PID OVA (ppm)	FIDLER Scan	Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.
1		3/5				7049 6871	0-1 Asphalt + Subbase
2	0.0 0.0 0.0 1111				2.7	6467 6360	1-2.5 Orange Brown Coarse Sand w/ some silt. many rounded river stones + cobbles. moist. trace light gray f-sand
3					3.1	6550 6468	2.5-3 Dark Gray. f-sand + silt. Tight, non-cohesive
4					-	-	3-5 No Recoveries
5		5/5				6716 6258	5-6 Orange Brown. M-C Sand w/ some silt
6					14.5	6693	6-7 Black peat
7			6.5 1.5		15.2	7051 6902	7-8 Dark light Gray f.m sand w/ some silt tight, some water, non-cohesive
8					39.6	6770	8-10 Light Brown M-C Sand w/ trace silt. Loose wet @ 9-Ft, some mottled light Gray m-silt, sand
9					26.2	6620 6397	
10					67.1	6268 6440	

Background Fidler 9091

Soil Boring Log

Boring No:

GMW 01

Boring Location info:

Project:

Proj. No.

OU 3 Phase 2

date: 11/29/05

page: 2

time: 800

of: 2

by: Joe Van Uden

water depth / time:

9-ft

water depth / time:

drilling method: Rotasonic

surface conditions:

diam: 4" / 12"

Asphalt

start/finish:

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	soil texture	Recovery well construction	sample depth	sample no.	OVA (ppm)	FIDLER Scan
11	0.0	5			19	6301
12	0.0				171	632
13	0.0				99.2	6919
14	0.0				271	640
15	0.0				201	6087
16	0.0				148	6065
17	0.0				117	6280
18	0.0				63.6	6819
19	0.0				24.1	6620
20	0.0					6100
						6292
						6272
						6113
						6007
						6005
						6219
						6866

10-12.5
Coarse light Brown sand w/ some small
river gravel. Loose, wet, non-cohesive

12.5-14.25
Light Gray & light Brown very f. sand w/ silt. T. fine
non-cohesive

14.25-15
Red Brown m.c sand w/ trace silt.
Semi-fine, non-cohesive

15-17.5
F.M. light Brown silty sand. Semi-fine
non-cohesive

17.5-20
M-C light Gray sand w/ trace silt.
Loose non-cohesive

Drilled out Borehole w/ 12-inch to 18. Ft
well GMW 01

Avg. Rise 0-8
0.01 screen 8-18
#0 Sand 6-18 8 BAGS
Asphalt 8-16
Sand 1.5-2 (chain man hole)



Soil Boring Log

Boring No:

6 MW 02

Boring Location info:

AOI- B₄

AOC-6

Project:

003 Phase 2

Proj. No.

date: 11/29/05

page: 1/2
of: 2

time:

by: JGE Van Uderit 2

water depth / time:

8.5 - FT

water depth / time:

drilling method: Rotasonic

diam: 4" / 12"

start/finish:

surface conditions:

Gravel / Asphalt

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	soil texture	soil construction	sample depth	sample. no.	OVA (ppm)	FIDLER Scan
0-1	old Asphalt & Gravel	3/5		2.5	4726 4580	
1-2.75	light brown c-sand w/ some small rounded river gravel. loose, non-cohesive			2.2	41605 41894	
2.75-3	Black Paint w/ trace f- Gray Sand. tight, semi-cohesive			3.0	5266 5107	
3-5	no Recovery			-	-	-
5-7.5	Brown / Red Brown M-C Sand w/ trace silt. loose, non-cohesive. moist	4/5		7.4	4731 4673	
7.5-9	Red Brown / light Gray / light brown mottled F-Sand w/ some silt. tight, non-cohesive. some water @ 8.5			6.6	4857 4954	
9-10	no Recovery			6.0	4926 5050	
* 8.9	Field Duplicate Sample collected		8.9	9.8	5210 5277	
				-	-	-

Background Fidler - 4677



CABRERA SERVICES
RADIOLOGICAL • ENVIRONMENTAL • REMEDIATION
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

64402

Boring Location info:

Project:

Proj. No.

date: 11/29/05

page: 2

time:

of: 2

by:

Joe Van Uderitz

water depth / time:

0.5 ft

water depth / time:

drilling method: Rotasonic

surface conditions:

diam: 4" / 12"

Asphalt / Gravel

start/finish:

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	soil texture	Pressure with construction	sample depth	sample. no.	OVA (ppm)	FIDLER Scan
11		5/5			10.6	4657
12					20.1	4756
13					13.3	4749
14					52	4794
15					20.4	4494
16		5/5			8.4	4820
17					21.6	4615
18					286	4742
19			18		387	4650
20			19		402	4821
						4754
						4648
						4837
						4882
						4783
						4885
						4908
						5089
						4890
						4952

10-13
Light Brown & light Gray
C-Sand w/ trace silt. loose, non-cohesive

13-15
Light Brown w/ some light Gray/Red Brown
F. Sand w/ some silt. Tight, non-cohesive
Semi-tight, non-cohesive

15-17
Light Gray M-F sand w/ some silt

17-19.5
Light Gray F.M. sand w/ some
silt. Semi-tight, non-cohesive

19.5-20
Red Brown C-M sand w/ trace silt
Loose, non-cohesive

TD = 20

Drilled out Borehole w/ 12"

Riser 0-8
0.01 Screen 8-18
#0 Sand 0-18

Bastite/Cut 2-6



Soil Boring Log

Boring No:

6 MW 03

Boring Location info:

Project:

Proj. No.

0103 Phase 2

date: 11/30/05

page:

time:

of:

by: JOE Van Uderitz

water depth / time:

9.5-ft

water depth / time:

drilling method: Rotasonic

diam: 4 1/2"

surface conditions:

old Asphalt

start/finish:

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

AOI - 4
AOC - 6

depth (show units)	soil texture	Recovery well construction	sample depth	sample. no.	PLD OVA (ppm)	FIDLER Scan	
0-1		5/5			7.9	5095	Asphalt + Subbase
1-3.25					3.8	5323 5332	Orange Brown M-C sand w/ some silt. Loose, non-cohesive, moist
3.25-4					3.6	5478 5610	Light Gray/Black V. fine sand + silt. tight, non-cohesive
4-5					4.4	5466 5766	Light Gray + Light Brown mottled m-sand w/ trace silt. Tight, non-cohesive wet @ 5-ft (may be from Road)
5-5.5		5/5			5.8	5640 5505	Black peat
5.5-8					16.1	5350 5400	Light Gray + Light Brown mottled M-sand + silt. Tight, semi-cohesive.
8-9			7.8		6.6	5426 5260	Brown M-sand w/ some silt. Loose, non-cohesive
9-9.5					13.8	5693 5793	Light Gray w/ small amt. Red Brown mottled M-sand w/ some silt. Extremely tight non-cohesive
9.5-10					11.7	5575 5564	Brown C-M sand w/ some silt. Loose wet @ 9.5-ft
					15.9	5459 5209	

FIDLER Background = 5042

Soil Boring Log

Boring No:

6 MW03

Boring Location info:

Project:

003 Phase 2

Proj. No.

date: 11/30/05

page: 2

time:

of: 2

by: JOE Van Udenitz

water depth / time:

9.5 ft

water depth / time:

drilling method:

Rotary

diam: 4" / 12"

start/finish:

surface conditions:

old Asphalt

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	soil texture	Recess well construction	sample depth	sample. no.	OVA (ppm)	FIDLER Scan
11	0.10 0.30	5/5			11.6	5221 6200
12	0.0				21.1	4792 5113
13	0.0				32.8	5008 5198
14					8.2	5093 5301
15					16.5	5102 5414
16		5/5			9.4	5104 5252
17			17		20.9	5210 5260
18			18		22.5	5518 5260
19					38.4	5621 5471
20					10.2	5224 5216

10-12.75
COARSE light Brown Sand + pea Gravel
loose, non-cohesive Some larger rounded cobbles

12.75-20
Light Gray M-Sand w/ trace silt.
loose, non-cohesive.

* More silt (same) 16-18 ft

Drilled out Borehole to 12 inches

Riser 0-8
0.0" Screen 8-18
0 Sand 6-23
Bentonite/Grout 2-6





CABRERA SERVICES
RADIOLOGICAL • ENVIRONMENTAL • REMEDIATION
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

6-MW-04

ring Location info:

Project:

FUGRAP D. PONT GW SI

Proj. No:

04-3406.00

date: 5-10-06

page: 1

time:

of: 2

by: CMY

water depth / time:

water depth / time:

drilling method: ROTASONIC

surface conditions:

diam: 10-IN BORE
4-IN WARES

start/finish: 1130 / 1200

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	soil texture	well construction	sample depth	sample no.	OVA (ppm)	FIDLER Scan
0						X
1					1	5099
						5544
2					2	5337
					1	5664
						5790
3						5845
						5662
4						X
5	///					5448
	///				1	5645
6	///					5817
	///				0	5705
7	///					5849
	///				0	5711
8	///				2	5713
	///					5652
9	///					5410
	///					5384
10	///					

COARSE SAND / GRAVEL / WOOD - FILL

CLAY - SANDY, MOTTLED SAND, MOTTLED
GRAY & BLACK

CLAY - SILTY GRAY

CLAY - SANDY, LIGHT
GRAY

CLAY - SILTY, LIGHT
GRAY, MODERATELY FIRM

(SAMPLE)

SAND, CLAYEY, LIGHT GRAY, YELLOW MOTTLED
SILT

BACKGROUND
(ccpm)

5566
5474

5235
5361



CABRERA SERVICES
RADIOLOGICAL • ENVIRONMENTAL • REMEDIATION
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:
6-MW-04

ring Location info:

Project:

Proj. No.

date: 5-10-06

page: 2

time:

of: 2

by:

water depth / time:

water depth / time:

drilling method: ROTASonic

1.5-IN BORE

diam: 4-IN GWT

surface conditions:

GRAVEL

start/finish:

1130 / 1200

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	soil texture	well construction	sample depth	sample no.	OVA (ppm)	FIDLER Scan	
10					2	5281	SAND, MED GRAINED POORLY-SORTED
11					1	5308	
12					3	5271/5178	SAND, MED GRAINED w/ GRAVEL WELL-SORTED
13					1	5087	LIGHT GRAY
14					3	5442	-----
15					1	5729	(SAMPLE)
16					2	5698	
17					2	5586	
18					2	5659	
19					1	5444	
20					2	5585	Dk brown to black sandy silt w/ mottles
21					4	5481	
22					0	5354/5487	
23					3	5178	Reddish brown fine to medium SAND
24					2	5034	
25					2	5178	
26							
27							
28							
29							
30							

No recovery

Soil Boring Log

Boring No:

C-MW-05

ring Location info:

NW POSITION REL TO
EAST ROAD DITCH

Project:

FUSRAP DuPont GW SI

Proj. No:

04-3406-00

date: 5-10-06

page: 1

time:

of: 2

by: CMY / RALLEN

water depth / time:

water depth / time:

drilling method: ROTASONIC

surface conditions:

diam: 10-IN BORE

GRAVEL LOT

start/finish: 4-IN CORE

elevation:

09240

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

4-IN

depth (show units)	soil texture	well construction	sample depth	sample no.	OVA (ppm)	FIDLER Scan	
0					0.5	4914	GRAVEL, SANDY, LIGHT BROWN
					0.3	5033	
1					4.1	4813	CLAY, SILTY, GRAVELLY, ORGANIC, BLACK
					5.6	4635 4741	FILL
2					14/20	5067	
3						X	
4	X					X	No recovery
5	X					X	
6					17	5033	CLAY AND RUBBLE, INCLUDING WOOD
					60	4830/ 4906	
7					105	4514	CLAY, SILTY, BLACK, ORGANIC
					9	4458	
8					11	4585	PEAT, BLACK
						5066	
9					7	5317	CLAY, SANDY, BLACK
						5249	
10					2	5316	SAND, SILTY, FINE GRAINED
						5262	POORLY SORTED, MOTTLED, GRAY

8 BACK: 5186 / 5376



CABRERA SERVICES
RADIOLOGICAL • ENVIRONMENTAL • REMEDIATION
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

6-MW-05

ring Location info:

Project:

FUSRAP DuPont BW SI

Proj. No:

04-3406-00

date: 5-10-06

page: 2

time:

of: 2

by: CMY

water depth / time:

water depth / time:

drilling method: ROTASONIC

10-IN BORING

diam: 4-IN CORE

surface conditions:

start/finish:

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	soil texture	well construction	sample depth	sample. no.	OVA (ppm)	FIDLER Scan
10						5270
11					232	5134
				3		5200
12				12	2	5027
				5		5213/5130
13					7	5189
14	X					X
15	X					X
16					0	5077
					1	4922/5008
17					1	5100
						5197
18						5160
					1	5105
19					3	5308
						5237
					2	5392
20						5074

SAND, MED GRAINED, POORLY SORTED,
LIGHT GRAY



SAND, MED GRAINED, W/ GRAVEL
WELL SORTED, YELLOWISH-ORANGE

SAND, MED. GRAINED, POORLY SORTED
LIGHT GRAY



GRADES TO DARK GRAY

SAND, FINE, POORLY SORTED, GREENISH GRAY

Soil Boring Log

Boring No:

6-MW-06

ring Location info:

EAST ROAD

ACC 6

Project: DuPont
Supplemental GW Investigation

Proj. No:
04-3406.00

date: 5/10/2006

page: 1
of: 2

time: 0745

by: CMY / RALLEN

water depth / time:

water depth / time:

drilling method: ROTASONIC

surface conditions:

diam: 10IN BORING

GRAVEL LOT

start/finish: 0800 - 0900

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

FURTH MOUNT
4-IN DIAM WELL
0.010 SLOT

depth (show units)	soil texture	well construction	sample depth	sample no.	OVA (ppm)	FIDLER Scan
1					0.1	X
2						X
3						X
4						X
5						X
6						X
7						X
8						X
9						X
10						X

GROUND SURFACE - GRAVEL LOT

NO RECOVERY

SAND, GRAVELLY, ORGANIC, BLACK

CLAY, SANDY, STIFF, BLACK

SILT, CLAYEY, LIGHT BROWN

SAND, SILTY, ~~FIN~~ LIGHT BROWN

5130 / 5332 = BG FIDLER



CABRERA SERVICES
RADIOLOGICAL • ENVIRONMENTAL • REMEDIATION
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

G-MW-06

Boring Location info:

Project:

DUPONT FUSRAP GW ST

Proj. No:

04-3406-00

date: 5-10-06

page: 2

time: 0805

of: 2

by: CM7 / RAUEN

water depth / time:

water depth / time:

drilling method: ROTASONIC

surface conditions:

diam: 10"

GRAVEL LOT

start/finish:

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	soil texture	well construction	sample depth	sample no.	OVA (ppm)	FIDLER Scan	
10					0.1	5231	SAND, COARSE, GRAVELLY
						5071	SAND MED GRAINED POORLY SORTED
11						5021 5090	↓ GRADES TO LIGHT GRAY
						5242	
12					0.1	5230	
						5123	
13					0.0	5017	SAND, MED GRAINED, CLAYEY, LIGHT BROWN
14						5249	
						X	NO RECOVERY
15					0.1	5014	SAND, MED GRAINED, POORLY SORTED
						4915	
16					0.4	5024	SAND, CLAYEY MED GRAINED
						5339	
17					0.4	5679/5743	SILT, LIGHT BROWN SAMPLE 17-5-18
18				19	0	5867	SILT, CLAYEY, LIGHT BROWN, SOFT
						5721	↓
19				19	0.6	5612	
					4.8	5320	SAMPLE 19-195 DUP
						5639	



CABRERA SERVICES
RADIOLOGICAL - ENVIRONMENTAL - REMEDIATION
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

6 MW-07

Boring Location info:

NORTH SIDE OF EAST RD
@ B ST.

AOC 6

Project: DUPONT
SUPPLEMENTAL
INVESTIGATION

Proj. No.

01-3406.00

date: 5/9/06

page:

time: 1000

1 of 5

C. YOUNG

By: D. KATELEY

water depth / time:

water depth / time:

drilling method: ROTOSonic

surface conditions:

diam: 4 IN CORE

GRAVEL LOT

start/finish:

elevation:

1030 /

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

FT. depth (show units)	Soil Texture	Well Construction	sample depth	sample no.	% recovery	P.O. SHA (ppm)	FIDLER Scan	
1	GRAVEL w/ SOME SAND, FILL (GW) LIGHT BROWN TO BLACK				70	7.9 5131 20.1 5039 0.1 5443		
2	CLAYEY SAND. (CL) MOIST, TAN					0.3 5356		
3	CLAY, TAN TO GRAY (CL)(ML)					0.2 5314 0.4 5255 0.4 5356		
4	CLAYEY SILT. MOIST					1.0 5315		
5	NO RECOVERY							
6	MEDIUM GRAIN GRAVELY SAND, SLIGHTLY MOIST, TAN IN COLOR. (SC) TO MEDIUM GRAY.				70	0.0 5114 0.2 5441 0.1 5434 3.5 5434		
7	SOME CLAYEY SAND FROM 5 FT TO 6.5 FT.					0.2 5372 3.5 5142		
8						6.6 5230 26.6 5194 26.6 5267		
9	NO RECOVERY							
10								

BACKGROUND = 5247 CPM
5087 CPM



CABRERA SERVICES
RADIOLOGICAL - ENVIRONMENTAL - REMEDIATION
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

6MW-07

Boring Location info:

EAST RD.

AOC 6

Project: DuPont
SUPPLEMENTAL
INVESTIGATION

Proj. No.

01-3406.00

date: 5/9/06

page:

time: 1000

2 of 5

By: C. YOUNG
D. KATELEY

M. DRISCOLL

water depth / time:

water depth / time:

drilling method: ROTASONIC

surface conditions:

diam: 4 IN CORE

GRAVEL LOT

start/finish:

elevation:

1030

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	Soil Texture	Well Construction	sample depth	sample no.	% recovery	R/D DVA (ppm)	FIDLER Scan	
11					100	5.0 5574		MED GRAY + TAN MOTTLED, VERY
						1.1 5527		MOIST. GRAVELLY, CLAYEY SAND. (SC)
						12.2 5061		SOME GRAVEL.
12						2.2 5271		
						3.2 5501		
						3.2 5364		
13						3.4 5564		DARK GRAY CLAYEY SILT, ORGANIC (CH)
						0.7 5265		MATTER, LOW MOISTURE
14						0.7 5439		CLAYEY SAND, TAN, MOIST. (SC)
						6.5 5211		SOME PLASTICITY
15						12.1 4983		SAND, TAN, MOIST (SW)
16					90	52.3 5165		MEDIUM GRAIN SAND, VERY MOIST,
						92.0 5148		TAN COLOR, ODOR (SW)
						30.2 5127		
17		X				2.5 5425		SAME AS ABOVE BUT SLIGHTLY
						2.5 5278		LESS MOIST. (SW)
18						2.5 5171		
						2.5 5591		
						5505		
19						2.5 5434		
						2.5 5313		
20								NO RECOVERY

Soil Boring Log

Boring No:

6 MW-07

Boring Location info:

EAST RD.

AOC-6

Project: DUPONT

Proj. No.

04-3406.00

date: 5/9/06

page: 3

time: 1000

of: 5

C. YOUNG

by: D. KATELEY

M. DRISCOLL

water depth / time:

water depth / time:

drilling method: ROTOSONIC

surface conditions:

diam: 4 IN. CORE

GRAVEL LOT

start/finish:

elevation:

1030

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

FT. depth (show units)	soil texture	well construction	sample depth	sample no.	RD GVA (ppm)	FIDLER Scan	
21					10	5220 5039 4895	SAND, WELL SORTED, TAN, MEDIUM- GRAINED (SW)
22					6	5098 5319	
23	X						NO RECOVERY
24	X						
25	X						
26			X		1.7	5238 5099	SAND, GRAVELLY, WELL-SORTED, TAN (SW) ORANGE COLOR LAST 1 FT.
27					6.2	5171 4857	
28					0.2	4838 4834 4836	
29	X				X	X	NO RECOVERY
30	X				X	X	



CABRERA SERVICES
RADIOLOGICAL • ENVIRONMENTAL • REMEDIATION
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No:

6-MW-07

Boring Location info:

EAST ROAD
AOC-6

Project: DUPONT

Proj. No.

04-3406-00

date: 5/9/06

page: 4

time: 1000

of: 5

By:

water depth / time:

water depth / time:

drilling method: ROTOSONIC

surface conditions:

diam: 4" CORE

GRAVEL LOT

start/finish:

1030

elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils, contamination, etc.

depth (show units)	Lithology	Well Construction	sample depth	sample. no.	% recovery	RIP OVA (ppm)	GM Scan	
31					70	0.1	4824 4596	SAND, GRAVELLY, WELL SORTED. TAN, MOIST (SW)
32						0.4	4951 4792	
33						1.1	4949 4789 5017	SAND GRAVELLY WELL SORTED LIGHT GRAY, (SW)
34						1.1	4914 5005	
35								NO RECOVERY
36					55	0.0	5235 5276 5738 5857	SAND, GRAVELLY, WELL SORTED. LIGHT TO DARK GRAY. MOIST COURSE SAND LAST 1.5 FT. (SW)
37						0.0	5827	
38						2.1	5674	
39								NO RECOVERY
40								



CABRERA SERVICES
PAEDOLOGICAL / ENVIRONMENTAL / REMEDIATION
WWW.CABRERASERVICES.COM

Soil Boring Log

Boring No: **6 MW-07**

Boring Location info:

EAST RD.

AOC-6

Project: **DUPONT**

Proj. No. **04-3406-00**

date: **5/9/06**
time: **1000**

page: **5**
of: **5**

by: **C. YOUNG**
D. KATZEY

M. DRISCOLL

water depth / time:

water depth / time:

drilling method: **ROTOSOLIC**
diam: **4 in CORE**
start/finish: **1030/**

surface conditions:
GRAVEL LOT
elevation:

Description: textures, color, moisture, odor, firmness, fractures, strata, cavities, fossils contamination, etc.

depth (show units)	soil texture	well construction	sample depth	sample no.	PID OVA (ppm)	FIDLER Scan	
41					1.3	5283 5393 5393 5322	DARK GRAY. SAND, GRAVELLY, WELL SORTED. MOIST. (SW) SLIGHT ODOR
42					0.5	5254	
43					1.8	5198	
44						/	
45						/	NO RECOVERY
46					1.2	5221 5168	
47					2.3	5117 5142 5107	
48					5.0	5297 5097	
49							NO RECOVERY
50							

100% RECOVERY

60% RECOVERY



SHEET: 1

Well No.: MW 20 A OF: 1

Date: 2/18/05

0-1.0' not above background

Include a monitoring well construction diagram with this form

[illegible]

Wm. D. D. D.



CABRERA SERVICES
ANALYTICAL - DESIGN/CONSTRUCTION - CONSULTING

MONITORING WELL CONSTRUCTION DIAGRAM


Project: DuPont
Project No.: _____
No.: _____

Boring No.: MW-70
Date: 7/18/05
Installed: 7/18/05

Drilling Company: Bowser-Morner
Driller: Bruce Kirkpatrick

Geologist: M. Phillips

Development Method: pump/surge

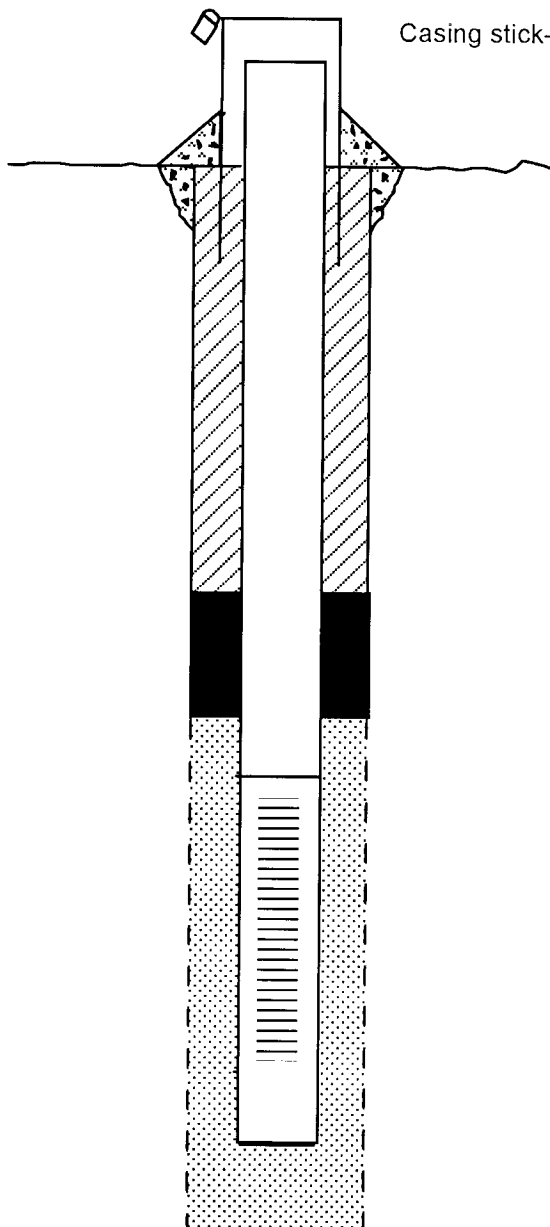

Casing stick-up relative to ground surface: 3 ft

Type of surface seal: concrete

Type of surface casing: square steel

ID of surface casing: 6"

Diameter of borehole: 8"

Riser pipe ID: 4"

Type of riser pipe: Sch 40 PVC

Type of backfill: sand

Depth to top of seal: 3.5' bgs

Type of seal: bentonite chip

Depth to top of sand: 4.5' bgs

Depth to top of screen: 5.0' bgs

Type of screen: Sch 40 PVC

Slot size & length: 10-slot, 2.5'

ID of screen: 4"

Type of sandpack: 00 quartz sand

Depth at bottom of screen: 7.3' bgs

Depth to bottom of sump: 7.5' bgs

Depth at bottom of borehole: 9.0' bgs

Notes:

GAMMA LOGGING DATA FORM

SHEET: 1

Project: Dupont

Well No.: MW-21 (A)

OF: 1

Project No.: _____

By: J-KAPP

Date: 7/14

0-0.5' reading @ background

Include a monitoring well construction diagram with this form

Depth [ft]	reading [cpm]
0.5	—
1	5155
1.5	5155
2	
2.5	
3	
3.5	
4	5653
4.5	5833
5	5852

Depth [ft]	reading [cpm]
5.5	5810
6	5346
6.5	5084
7	5178
7.5	5654
8	5336
8.5	5247
9	5278
9.5	5113
10	5330

Depth [ft]	reading [cpm]
10.5	4775
11	4985
11.5	5016
12	5010
12.5	5140
13	5200
13.5	5412
14	5341
14.5	
15	



CABRERA SERVICES
WATER & WASTE CONSTRUCTION

MONITORING WELL CONSTRUCTION DIAGRAM


Project: DuPont
Project No.: _____

Boring No.: MW-21
Date: 7/14/05
Installed: _____

Drilling Company: Bowser-Morner
Driller: Bruce Kirkpatrick

Geologist: M. Phillips

Development Method: pump/surge

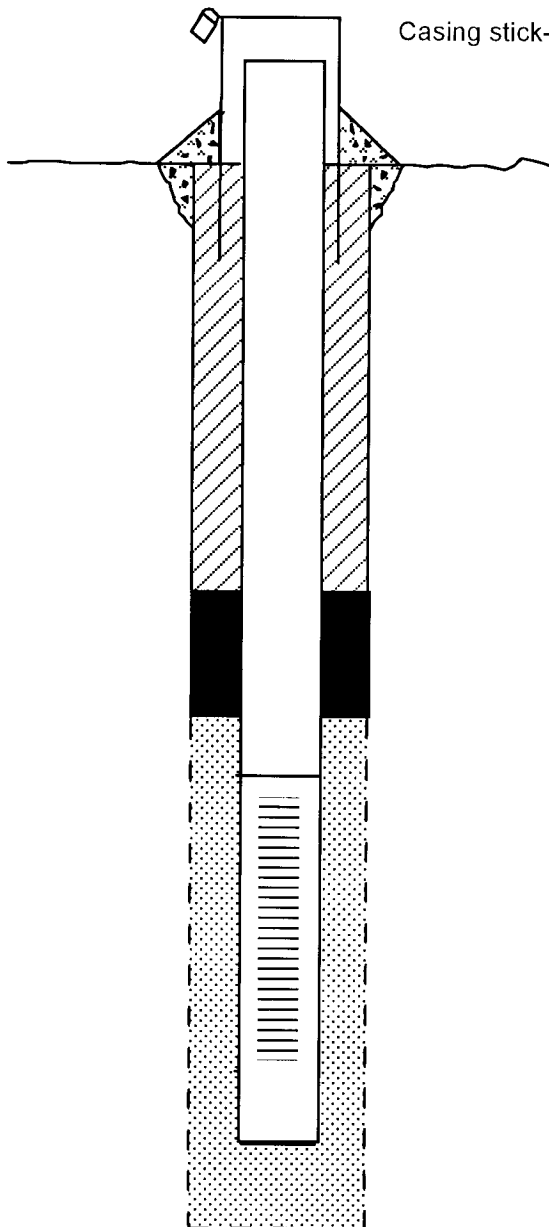

Casing stick-up relative to ground surface: 3 ft

Type of surface seal: concrete

Type of surface casing: 40 SCH steel

ID of surface casing: 6"

Diameter of borehole: 8"

Riser pipe ID: 4"

Type of riser pipe: 40 SCH PVC

Type of backfill: sand

Depth to top of seal: 5.0' bgs

Type of seal: bentonite chip

Depth to top of sand: 6.0' bgs

Depth to top of screen: 6.5' bgs

Type of screen: 40 SCH PVC

Slot size & length: 10-slot, 2.5'

ID of screen: 4"

Type of sandpack: 00 quartz sand

Depth to bottom of screen: 8.8' bgs

Depth to bottom of sump: 9.0' bgs

Depth to bottom of borehole: 14.0' bgs

Notes:

GAMMA LOGGING DATA FORM

SHEET: 1

Project: Defect

Well No.: 9W-22 OF: 1

Project No.:

By: Ned Morgan

Date: 7/5/05

0-1.0' not above background

Include a monitoring well construction diagram with this form

* CONTACT ON SAMPLE

[illegible]



CABRERA SERVICES
ANALYTICAL & CONSULTING

MONITORING WELL CONSTRUCTION DIAGRAM


Project: DuPont
Project No.: _____

Boring No.: MW-22
Date: _____
Installed: 7/16/05

Drilling Company: Bowser-Morner
Driller: Bruce Kirkpatrick

Geologist: M Phillips

Development Method: pump/surge

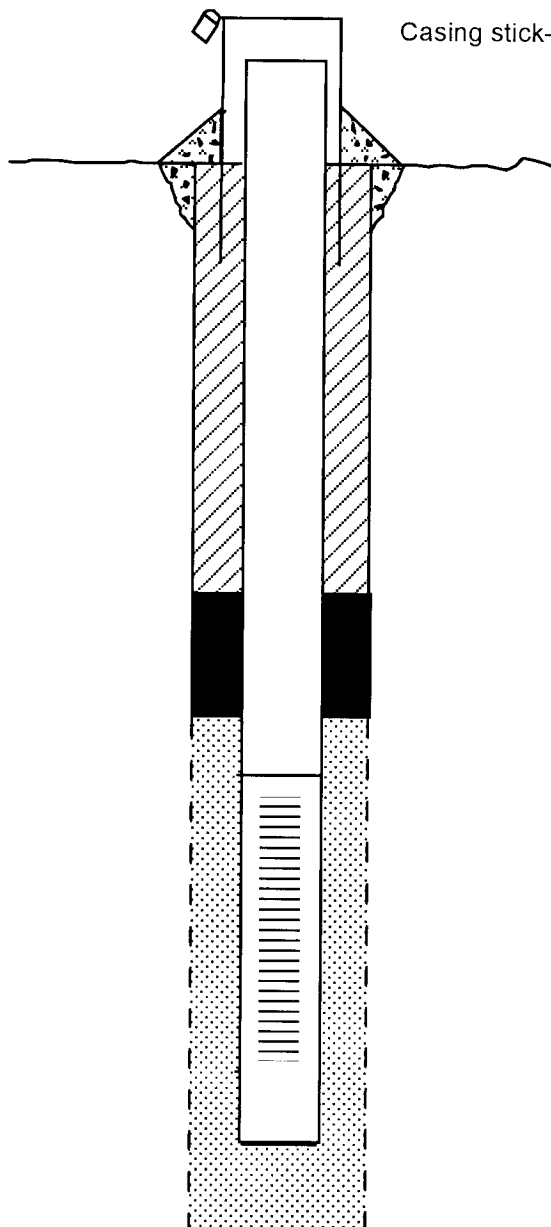

Casing stick-up relative to ground surface: 3 ft

Type of surface seal: concrete

Type of surface casing: square steel

ID of surface casing: 6"

Diameter of borehole: 8"

Riser pipe ID: 4"

Type of riser pipe: Sch 40 PVC

Type of backfill: sand

Depth to top of seal: 3.0' bgs

Type of seal: benetomite chip

Depth to top of sand: 4.0' bgs

Depth to top of screen: 4.5' bgs

Type of screen: Sch 40 PVC

Slot size & length: 10-slot, 2.5'

ID of screen: 4"

Type of sandpack: quartz sand

Depth of bottom of screen: 6.8' bgs

Depth to bottom of sump: 7.0' bgs

Depth of bottom of borehole: 9.0' bgs

Notes:



SHEET: 1

Dust

MCW-23

OF:

Ned Morgan

Date: 7/18/05

0.2.0' not above background

Include a monitoring well construction diagram with this form

[illegible]



CABRERA SERVICES

MONITORING WELL CONSTRUCTION DIAGRAM


Project: DuPont
Project No.: _____

Boring No.: MW-23
Date Installed: 7/18/05

Drilling Company: Burser-Morner
Driller: Bruce Kirkpatrick

Geologist: M. Phillips

Development Method: pump/surge

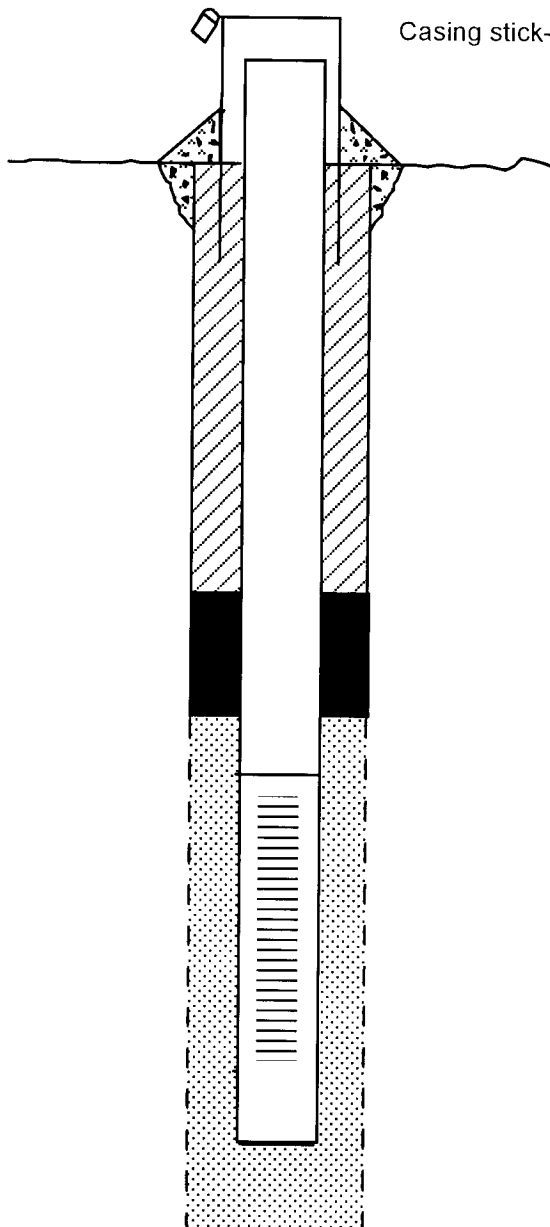

Casing stick-up relative to ground surface: 3 ft

Type of surface seal: concrete

Type of surface casing: square steel

ID of surface casing: 6"

Diameter of borehole: 8"

Riser pipe ID: 4"

Type of riser pipe: Sch 40 PVC

Type of backfill: N/A

Depth to top of seal: 6.5' bgs

Type of seal: heatwite chip

Depth to top of sand: 7.5' bgs

Depth to top of screen: 8.0' bgs

Type of screen: Sch 40 PVC

Slot size & length: 10-slot, 10.0'

ID of screen: 4"

Type of sandpack: 00 quartz sand

Depth of bottom of screen: 17.7' bgs

Depth to bottom of sump: 18.0' bgs

Depth of bottom of borehole: 18.0' bgs

Notes:

MONITORING WELL CONSTRUCTION DIAGRAM

Project: Defont
Project
No.:


Boring
No.: MW-24
Date
Installed: 7/17/05

Drilling
Company: Bauer-Morner

Driller: Bruce Kirkpatrick

Geologist: M. Phillips

Development Method: Pump/ Surge

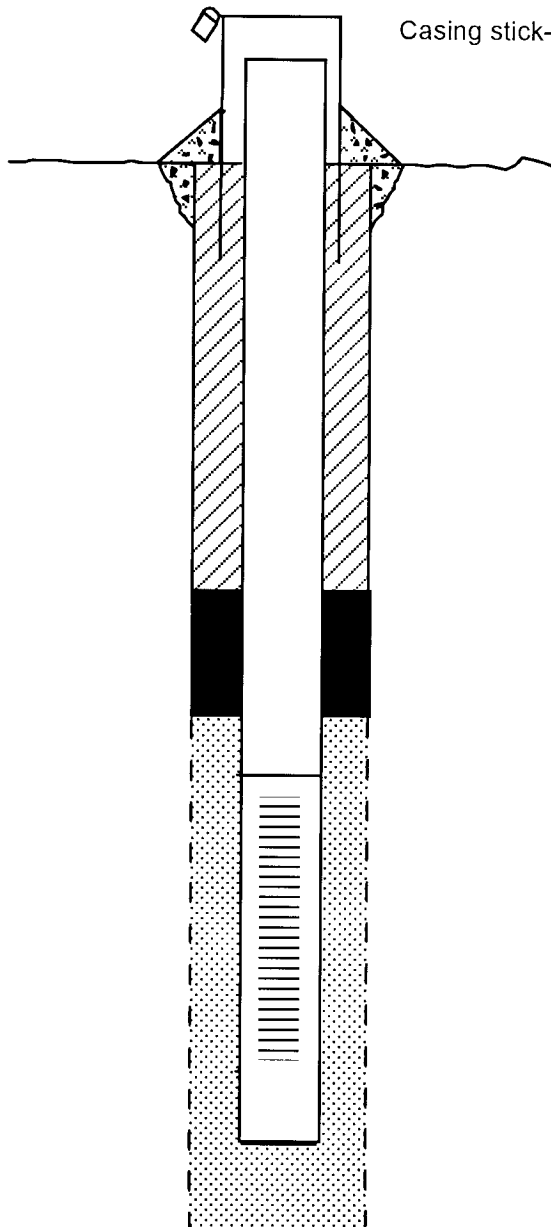

Casing stick-up relative to ground surface: 3 ft

Type of surface seal: *concrete*

Type of surface casing: square steel

ID of surface casing: 6"

Diameter of borehole: 8"

Riser pipe ID: 4"

Type of riser pipe: SEL 40 PVC

Type of backfill: Sand

Depth to top of seal: 4.0' bgs

Type of seal: bentonite chip

Depth to top of sand: 5.0' bgs

Depth to top of screen: 5.5' bgs

Type of screen: Sh 40 PVC

Slot size & length: 10-slot, 2.5'

ID of screen: 4/11

Type of sandpack: Open 2 sand

Depth of bottom of screen: 7.8' by 2

Depth to bottom of sump: 8.0' Lms

Depth of bottom of borehole: 9.0' bgs

Notes:

MONITORING WELL CONSTRUCTION DIAGRAM


Project: DuPont
Project No.: _____
No.: _____

Boring No.: MW-25
Date: _____
Installed: 11-14-05

Drilling Company: Boart Longyear
Driller: Jon Weeks

Geologist: J. Von Uderitz

Development Method: Pump/Surge

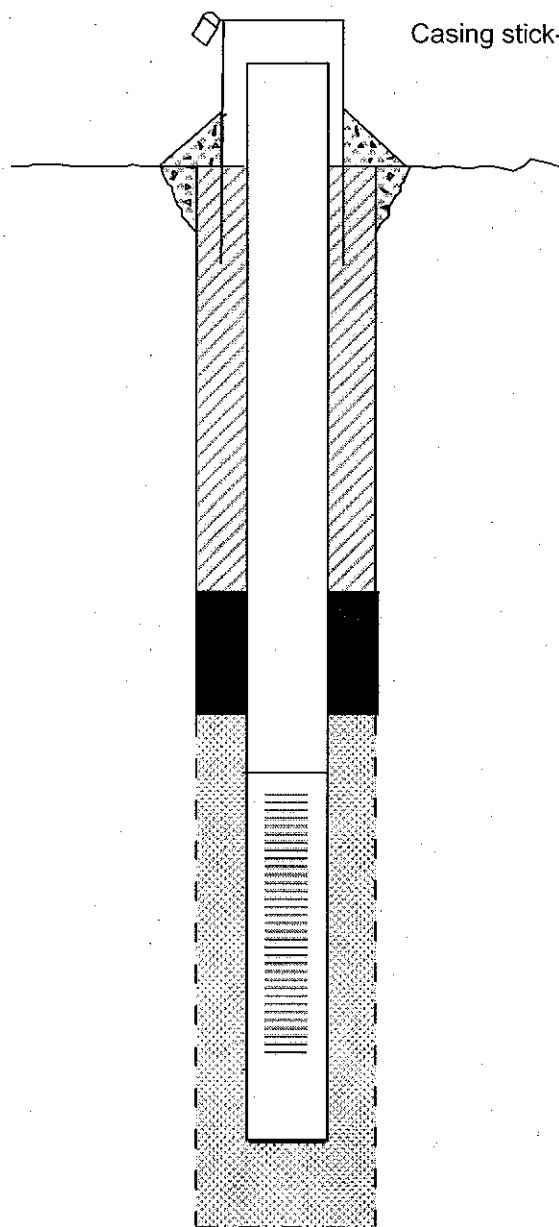

Casing stick-up relative to ground surface: 3 ft.

Type of surface seal: Concrete

Type of surface casing: Steel

ID of surface casing: 6"

Diameter of borehole: 8"

Riser pipe ID: 4"

Type of riser pipe: Sch 40 PVC

Type of backfill: Grout

Depth to top of seal: 28

Type of seal: bentonite chip

Depth to top of sand: 29.5

Depth to top of screen: 30

Type of screen: Sch 40 PVC

Slot size & length: 10-slot, 5ft

ID of screen: 4"

Type of sandpack: 00 Quartz Sand

Depth of bottom of screen: 34.5

Depth to bottom of sump: 35

Depth of bottom of borehole: 35

Notes:



SHEET: 1

Well No.: MW-26 OF: 1

Date: 7/17/05

0-1.5' readings at background

Include a monitoring well construction diagram with this form

4164



CABRERA SERVICES
WATER RESOURCES • GROUNDWATER • SURFACE WATER

MONITORING WELL CONSTRUCTION DIAGRAM


Project: DuPont
Project No.: _____
No.: _____

Boring No.: MW-26
Date Installed: 7/17/05

Drilling Company: Burser-Morner
Driller: Bruce Kirkpatrick

Geologist: M. Phillips

Development Method: pump/large

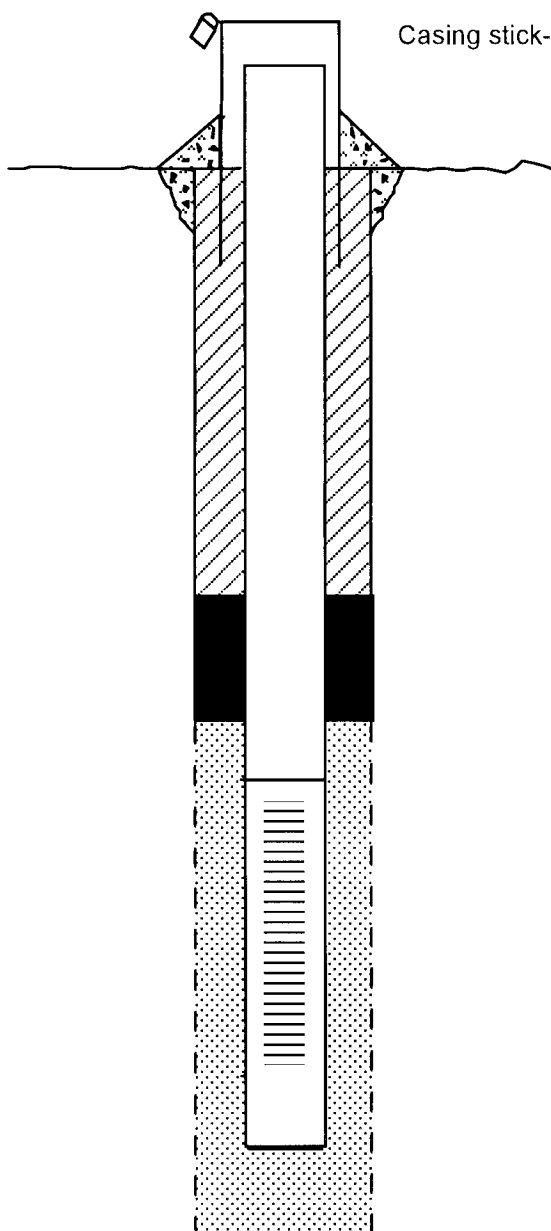

Casing stick-up relative to ground surface: 3 ft

Type of surface seal: concrete

Type of surface casing: square steel

ID of surface casing: 6"

Diameter of borehole: 8"

Riser pipe ID: 4"

Type of riser pipe: Sch 40 PVC

Type of backfill: sand

Depth to top of seal: 4.5' bgs

Type of seal: bentonite chips

Depth to top of sand: 5.5' bgs

Depth to top of screen: 6.5' bgs

Type of screen: Sch 40 PVC

Slot size & length: 10-slot, 2.5'

ID of screen: 4"

Type of sandpack: CO quartz sand

Depth to bottom of screen: 7.8' bgs

Depth to bottom of sump: 8.0' bgs

Depth to bottom of borehole: 12.0' bgs

Notes:



CABRERA SERVICES
ANALYSIS - DESIGN - CONSTRUCTION - MAINTENANCE

MONITORING WELL CONSTRUCTION DIAGRAM

Dupont

Project: Supplemental Investigation

Boring

No.: 4-MW-01

Drilling

Company: Boart Longyear

Project

Date

No.: 04-3406.00

Installed: 5-8-06

Driller:


John Weeks

Geologist:

Ken Marion

Development

Method: Surge block

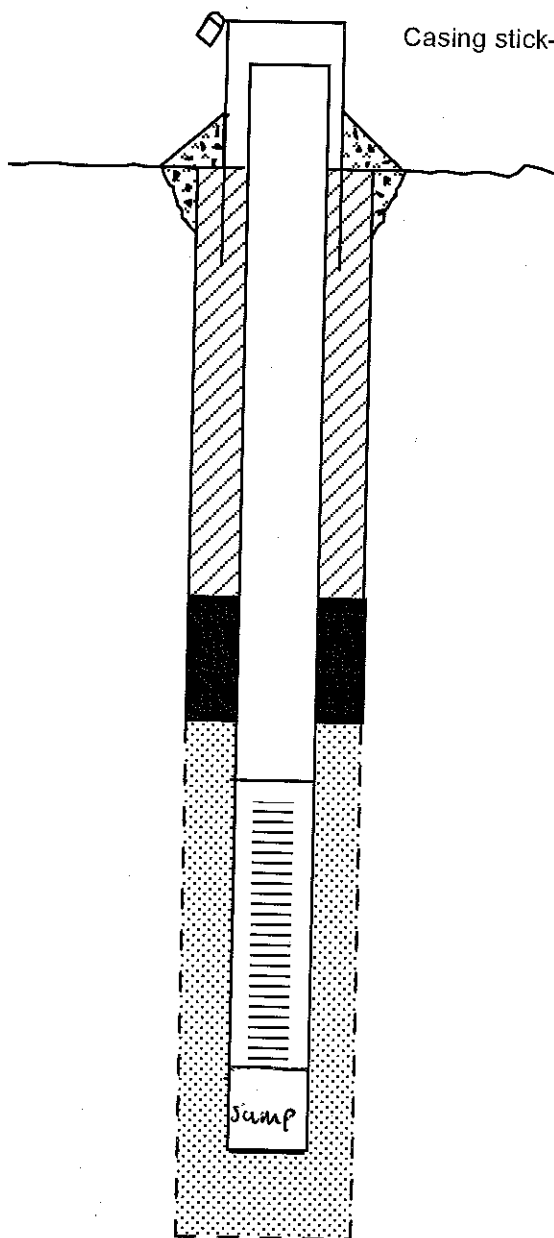

Casing stick-up relative to ground surface: ~3'

Type of surface seal: Cement

Type of surface casing: Steel

ID of surface casing: 6-inch

Diameter of borehole: 10-inches

Riser pipe ID: 4-inch

Type of riser pipe: Schedule 40 PVC

Type of backfill: Cement grout mix

Depth to top of seal: 5.6

Type of seal: Bentonite chips

Depth to top of sand: 7.6

Depth to top of screen: 9.6

Type of screen: Schedule 40 PVC

Slot size & length: 10, 10 ft

ID of screen: 4-inch

Type of sandpack: 00 Sand

Depth of bottom of screen: 19.6

Depth to bottom of sump: 20

Depth of bottom of borehole: 20

Notes: 4-inch sump

13 bags of sand


2 bags bentonite chips (hole plug)



CABRERA SERVICES

MONITORING WELL CONSTRUCTION DIAGRAM


Project: DuPont
 Project: Supplementary Investigation
 No.: 04-3406.00
 Boring No.: 4 MW-02
 Date: 5-8-06
 Installed: 5-8-06
 Drilling Company: Bart Longyear
 Driller: John Weeks
 Development Method: Surge Block
 Geologist: Ken Marston, Dana Kateley

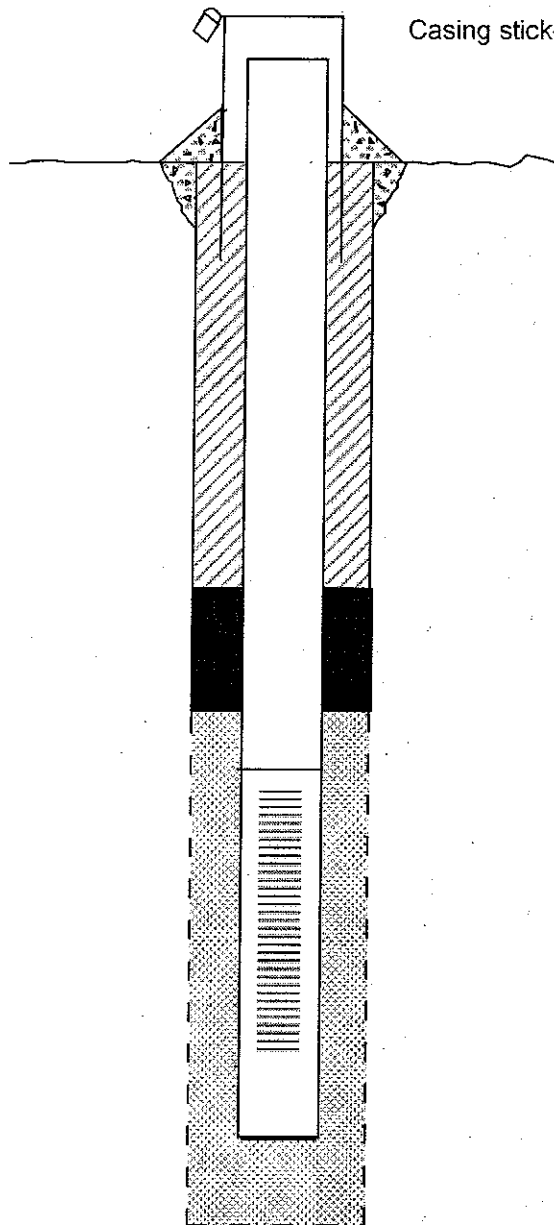Casing stick-up relative to ground surface: ~3'Type of surface seal: CementType of surface casing: SteelID of surface casing: 6-inchDiameter of borehole: 10-inchRiser pipe ID: 4-inchType of riser pipe: Sch 40 PVCType of backfill: Cement Grout MixDepth to top of seal: 3.1Type of seal: Bentonite chipsDepth to top of sand: 5.1Depth to top of screen: 7.1Type of screen: Sch 40 PVCSlot size & length: 10, 2-5 ftID of screen: 4-inchType of sandpack: 00 SandDepth of bottom of screen: 9.6Depth to bottom of sump: 10Depth of bottom of borehole: 10

Notes: 4-inch sump
4 Bags Sand
3 Bags Hole Plug

MONITORING WELL CONSTRUCTION DIAGRAM

Du Pont
 Project: Supplementary Investigation Boring No.: 4 MW-05 Drilling Company: Boart Longyear
 Project No.: 04-3406-00 Date: 5-8-06 Driller: John Weeks
 Geologist: Ken Marion/Dave Keteley Development Method: Surge Block

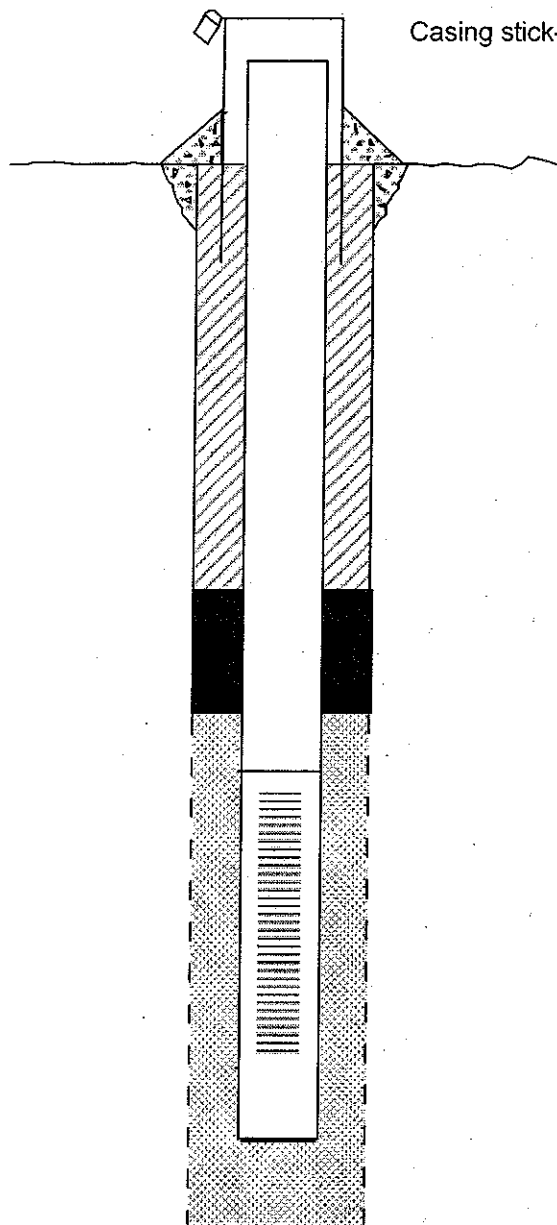

Casing stick-up relative to ground surface: 23'
 Type of surface seal: Cement
 Type of surface casing: Steel
 ID of surface casing: 6-inch
 Diameter of borehole: 10-inch
 Riser pipe ID: 4-inch
 Type of riser pipe: Sch 40 PVC
 Type of backfill: Cement Grout mix
 Depth to top of seal: 3.1
 Type of seal: Bentonite chips
 Depth to top of sand: 5.1
 Depth to top of screen: 7.1
 Type of screen: Sch 40 PVC
 Slot size & length: 10, 2.5 ft
 ID of screen: 4-inch
 Type of sandpack: 00 Sand
 Depth of bottom of screen: 9.6
 Depth to bottom of sump: 10
 Depth of bottom of borehole: 10

Notes: 4-inch Sump
4 Bags Sand
3 Bags Hole Plug



CABRERA SERVICES

MONITORING WELL CONSTRUCTION DIAGRAM

Project: DUPONT
SUPPLEMENTAL
 Project: INVESTIGATION
 No.: 04-3406.00


Boring No.: 4 MW-06
 Date: 5/9/06
 Installed: 5/9/06

Drilling Company: BOAET LONGYEAR

Driller: JOHN WEEKS

Geologist: D. KATELEY

Development Method: SURGE BLOCK

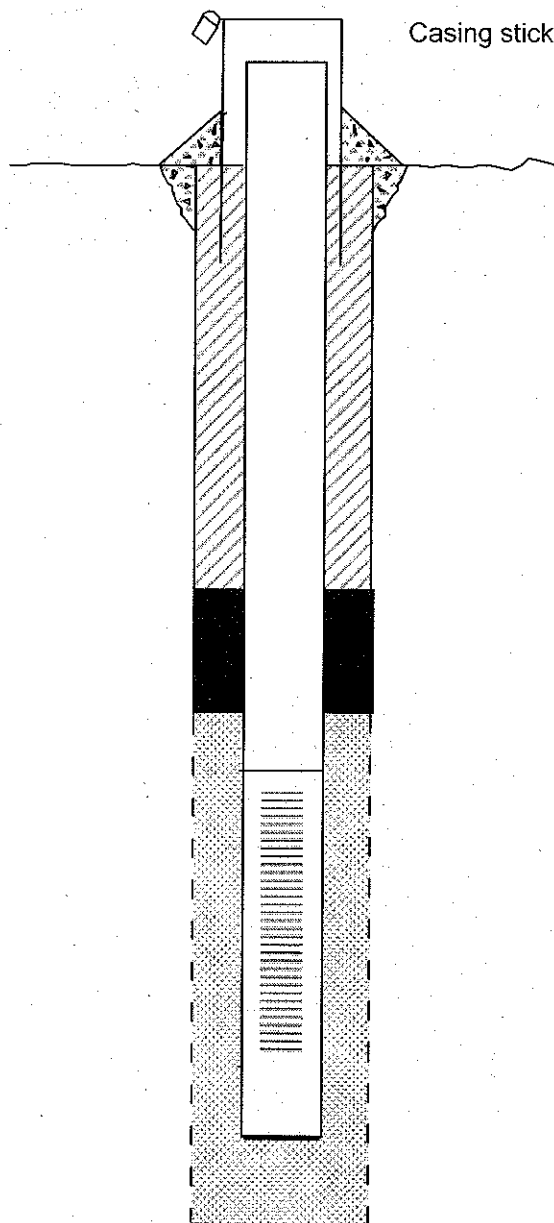

Casing stick-up relative to ground surface: ~ 3 FT

Type of surface seal: CEMENT

Type of surface casing: STEEL

ID of surface casing: 6 IN.

Diameter of borehole: 10 IN.

Riser pipe ID: 4 IN.

Type of riser pipe: SCH. 40 PVC

Type of backfill: CEMENT GROUT MIX

Depth to top of seal: 4 FT

Type of seal: BENTONITE CHIPS

Depth to top of sand: 5 FT.

Depth to top of screen: 5.5 FT

Type of screen: SCH. 40 PVC

Slot size & length: 10, 2.5 FT

ID of screen: 4 IN

Type of sandpack: 00 SAND

Depth of bottom of screen: 8

Depth to bottom of sump: 10

Depth of bottom of borehole: 10

Notes: 4 IN. SUMP

4 BAGS SAND


3 BAGS HOLE PLUG



CABRERA SERVICES

MONITORING WELL CONSTRUCTION DIAGRAM

DuPont
Project: Supplementary Investigation Boring No.: 4 MW-07 Drilling Company: Boart Longyear
Project No.: 04-3406.00 Date: 5-8-06 Driller: John Weeks
Geologist: Ken Marion/Dave Keteley Development Method: Surge Block

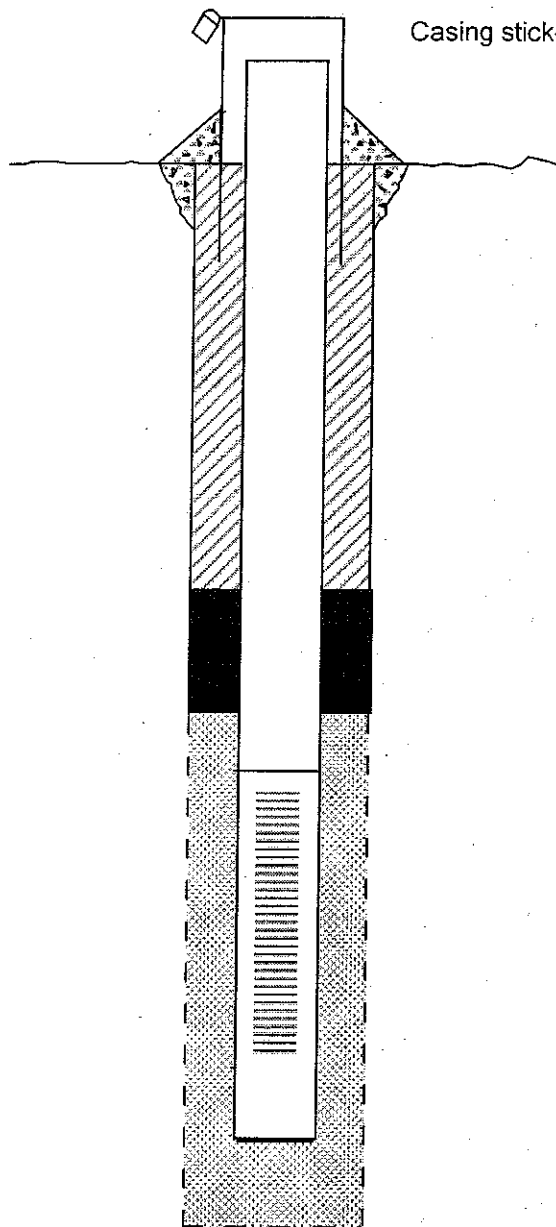Casing stick-up relative to ground surface: ~ 3'Type of surface seal: CementType of surface casing: SteelID of surface casing: 6-inchDiameter of borehole: 10-inchRiser pipe ID: 4-inchType of riser pipe: Sch 40 PVCType of backfill: Cement grout mixDepth to top of seal: 3.1Type of seal: Bentonite chipsDepth to top of sand: 5.1Depth to top of screen: 7.1Type of screen: Sch 40 PVCSlot size & length: 10, 2.5 ftID of screen: 4-inchType of sandpack: 00 SandDepth of bottom of screen: 9.6Depth to bottom of sump: 10Depth of bottom of borehole: 10Notes: 4-inch Sump4 Bags Sand3 Bags Hole Plug



CABRERA SERVICES
NATURAL CYCLICAL • ENVIRONMENTAL • REMEDIATION

MONITORING WELL CONSTRUCTION DIAGRAM

Project: _____
Project No.: _____


Boring No.: AT 6 MW 01
Date: _____
Installed: 11/29/05

Drilling Company: Boyer Longyear

Driller: Sam Weeks

Geologist: Joe Van Wert?

Development Method: Rotasonic

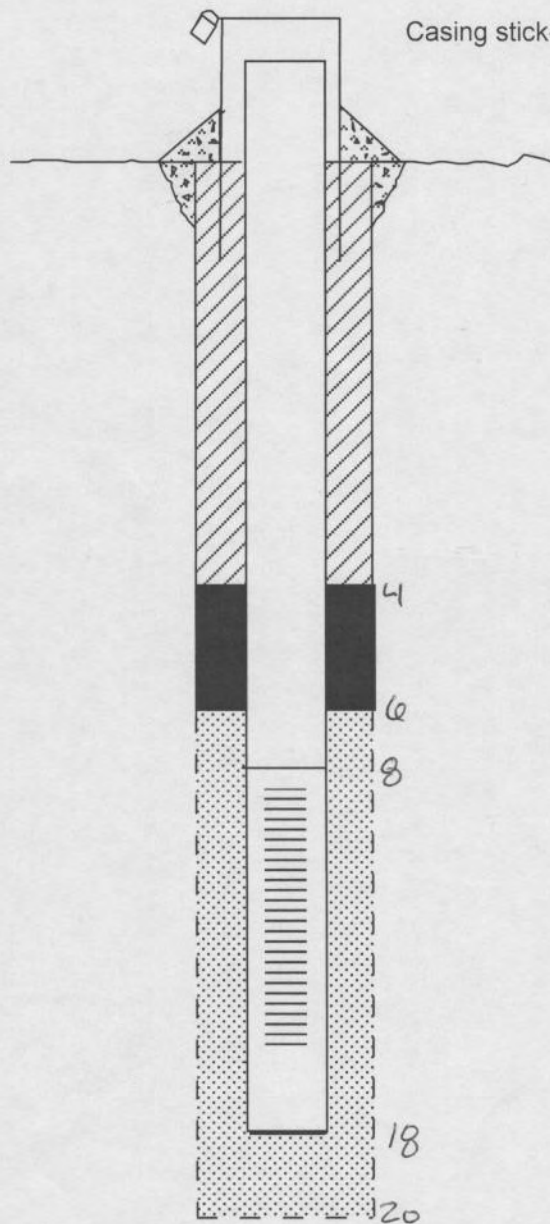

Notes:

.....
.....
.....

MONITORING WELL CONSTRUCTION DIAGRAM

Project: _____
Project No.: _____


Boring No.: 6Mw02
Date Installed: 11/29/05

Drilling Company: DuPont Longyear

Driller: Sam Weeks

Geologist: Joe Van Uder

Development Method: Rotasonic

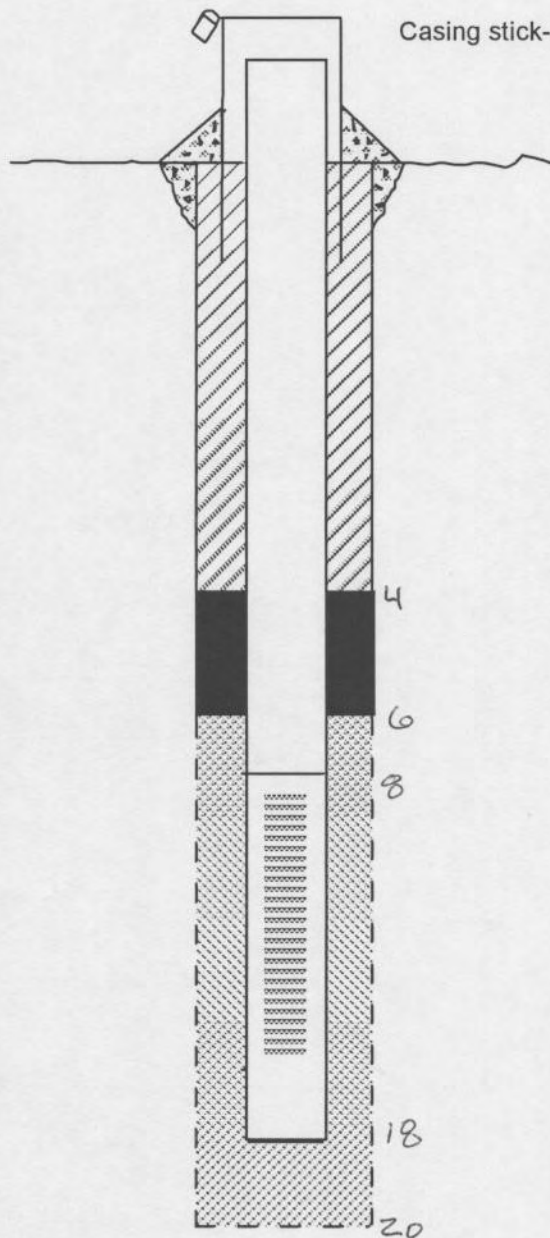

Casing stick-up relative to ground surface: Flush

Type of surface seal: Concrete

Type of surface casing: Steel Flushmount

ID of surface casing: 8-inch Flushmount

Diameter of borehole: 12-inch

Riser pipe ID: 4-inch

Type of riser pipe: Sch 40 PVC

Type of backfill: #0 Sand

Depth to top of seal: 4-6 + 2-4

Type of seal: Bentonite + Grout

Depth to top of sand: 6-Ft

Depth to top of screen: 8-Ft

Type of screen: Sch 40 0.01" slot

Slot size & length: 0.01"/10-Ft

ID of screen: 4-inch

Type of sandpack: #0

Depth to bottom of screen: _____

Depth to bottom of sump: _____

Depth to bottom of borehole: 20-Ft

Notes: _____



MONITORING WELL CONSTRUCTION DIAGRAM

Project: _____
Project No.: _____


Boring No.: 6MW03
Date Installed: 11/30/05

Drilling Company: Robert Longyear

Driller: Tom Weeks

Geologist: Joe Van Idewitz

Development Method: Rotasonic

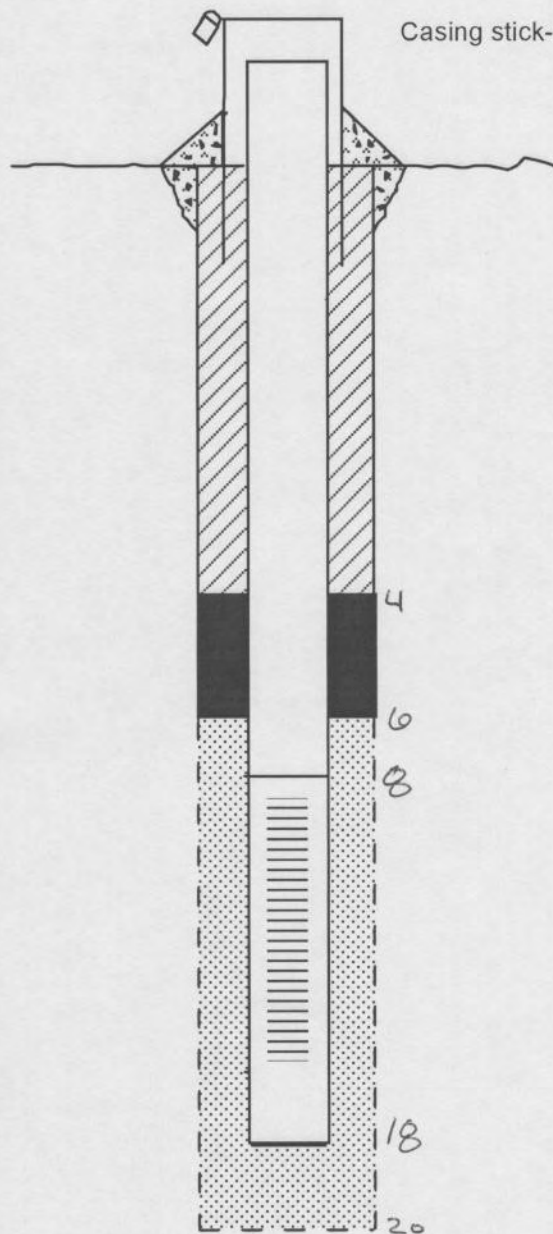

Casing stick-up relative to ground surface: Flush

Type of surface seal: Concrete

Type of surface casing: Steel Flushmount

ID of surface casing: 8-inch Flushmount

Diameter of borehole: 12-inch

Riser pipe ID: 4-inch

Type of riser pipe: Sch 40 PVC

Type of backfill: #20 Sand

Depth to top of seal: 4-6 + 2-4

Type of seal: Bentonite + Grout

Depth to top of sand: 6-Ft

Depth to top of screen: 8-Ft

Type of screen: Sch 40 0.01" slot

Slot size & length: 0.01" / 10-Ft

ID of screen: 4-inch

Type of sandpack: #20

Depth of bottom of screen: _____

Depth to bottom of sump: _____

Depth of bottom of borehole: 20-Ft

Notes:




CABRERA SERVICES

MONITORING WELL CONSTRUCTION DIAGRAM

Project: Dupont
Project: Supplementary Investigation
No.: 04-3406.00
Geologist: Carl Young

Boring No.: 6-MW-04
Date: 5-10-06
Installed: 5-10-06

Drilling Company: Beart Longyear
Driller: John Weeks
Development Method: Surge Block

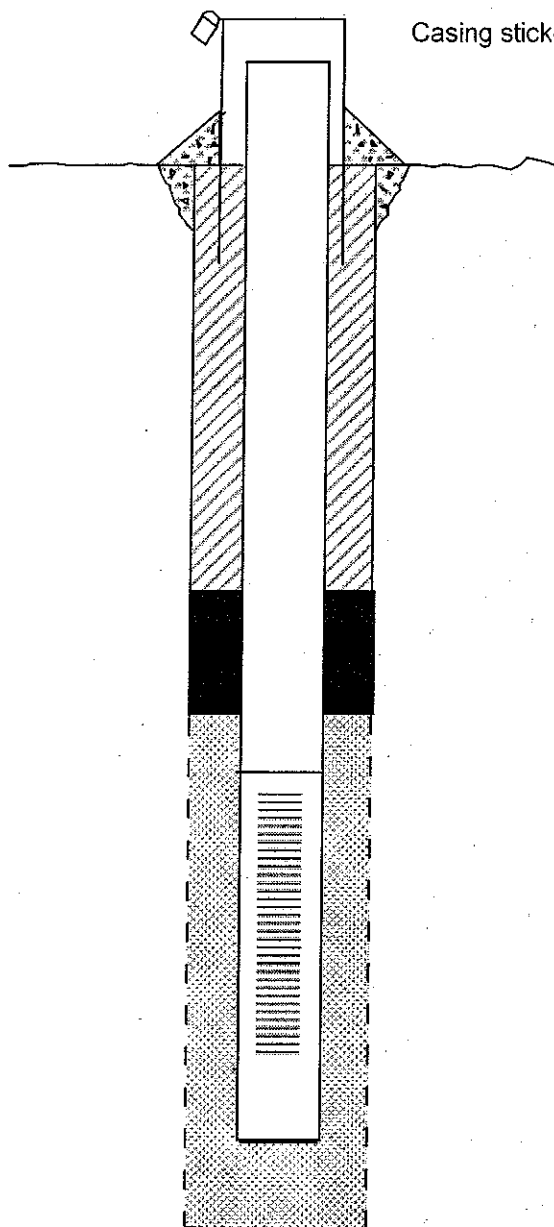Casing stick-up relative to ground surface: Flush MountType of surface seal: CementType of surface casing: ManholeID of surface casing: 10-inchDiameter of borehole: 10-inchRiser pipe ID: 4-inchType of riser pipe: Sch 40 PVCType of backfill: Cement grout mixDepth to top of seal: 5.6Type of seal: Bentonite chipsDepth to top of sand: 7.6Depth to top of screen: 9.6Type of screen: Sch 40 PVCSlot size & length: 10, 10 ftID of screen: 4-inchType of sandpack: 00 sandDepth of bottom of screen: 19.6Depth to bottom of sump: 19.6 20Depth of bottom of borehole: 20Notes: 4-inch sump




CABRERA SERVICES

MONITORING WELL CONSTRUCTION DIAGRAM

Project: DuPont
Project: Supplementary Investigation
No.: 04-3406.00
Geologist: Carl Young


Boring No.: 6-MW-05
Date: 5-10-06
Installed: 5-10-06

Drilling Company: Beart Longear
Driller: John Weeks
Development Method: Surge Block

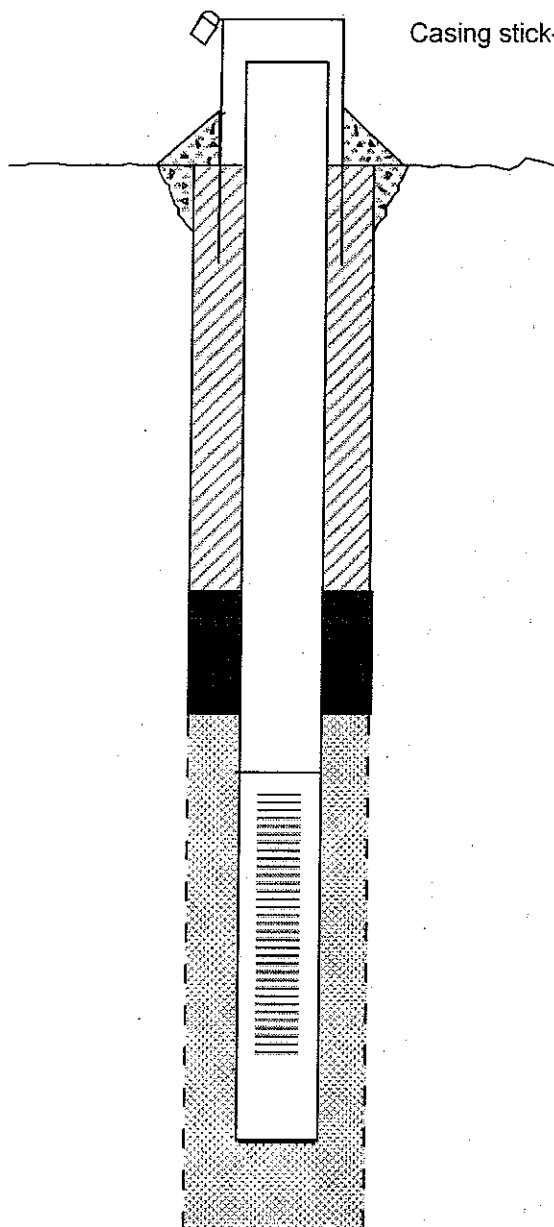Casing stick-up relative to ground surface: Flush MountType of surface seal: CementType of surface casing: ManholeID of surface casing: 10-inchDiameter of borehole: 10-inchRiser pipe ID: 4-inchType of riser pipe: sch 40 PVCType of backfill: Cement grout mixDepth to top of seal: 5.6Type of seal: Bentonite chipsDepth to top of sand: 7.6Depth to top of screen: 9.6Type of screen: sch 40 PVCSlot size & length: 10, 10 ftID of screen: 4-inchType of sandpack: 00 sandDepth to bottom of screen: 19.6Depth to bottom of sump: 20Depth to bottom of borehole: 20Notes: 4-inch sump

MONITORING WELL CONSTRUCTION DIAGRAM

Project: DuPont
 Project: Supplementary Investigation
 No.: 04-3406.00
 Boring No.: 6-MW-06
 Date: 5-10-06
 Installed: 5-10-06
 Drilling Company: Boart Longyear
 Driller: John Weeks
 Development Method: Surge Block
 Geologist: Carl Young

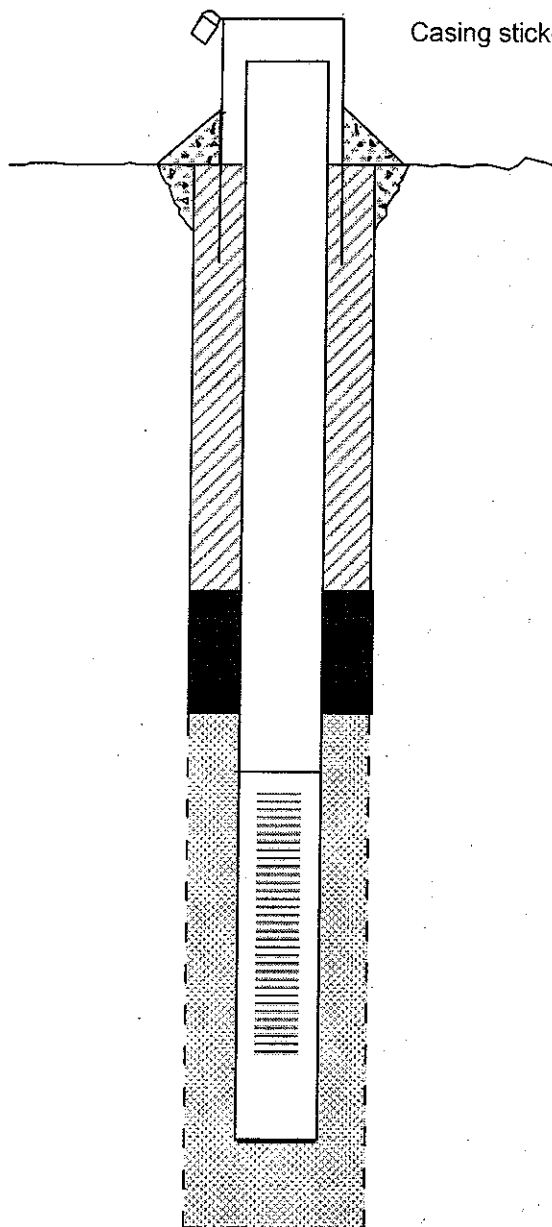

Casing stick-up relative to ground surface: Flush Mount

Type of surface seal: Cement

Type of surface casing: Manhole

ID of surface casing: 10-inch

Diameter of borehole: 10-inch

Riser pipe ID: 4-inch

Type of riser pipe: Sch 40 PVC

Type of backfill: Cement grout mix

Depth to top of seal: 5.6

Type of seal: Bentonite chips

Depth to top of sand: 7.6

Depth to top of screen: 9.6

Type of screen: Sch 40 PVC

Slot size & length: 10, 10 ft

ID of screen: 4-inch

Type of sandpack: 00 Sand

Depth of bottom of screen: 19.6

Depth to bottom of sump: 20

Depth of bottom of borehole: 20


Notes: 4-inch Sump



CABRERA SERVICES

MONITORING WELL CONSTRUCTION DIAGRAM

Project: DuPont Boring No.: 6-MW-07 Drilling Company: Boart Longyear
Project: Supplementary Investigation Date: 5-9-06 Driller: John Weeks
No.: 04-3406.00 Installed: 5-9-06 Development Method: Surge Block
Geologist: Carl Young, Dave Kateley

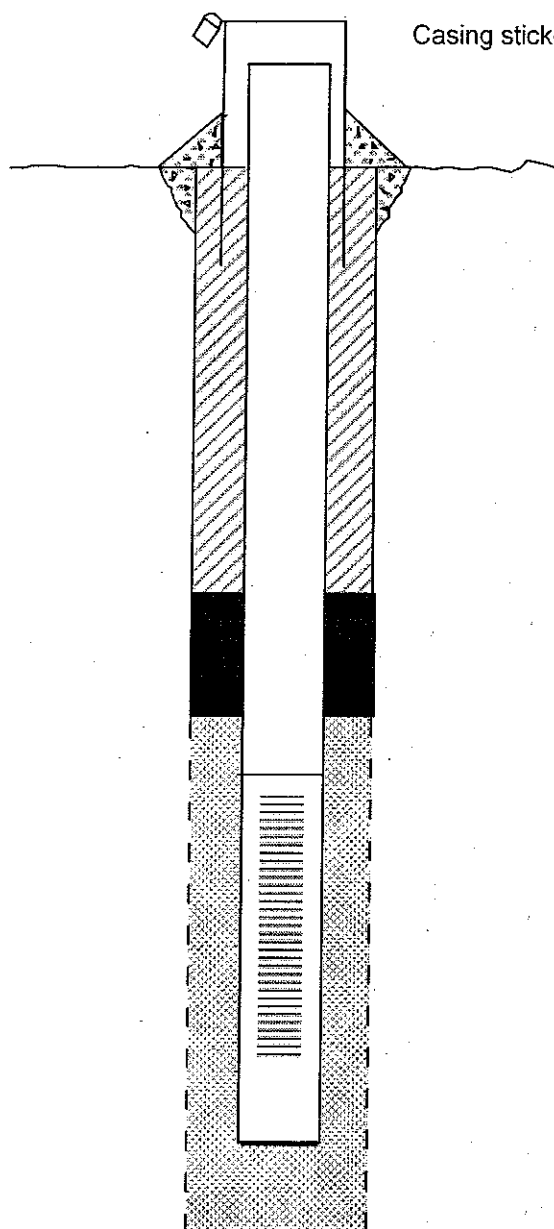Casing stick-up relative to ground surface: Flush MountType of surface seal: CementType of surface casing: ManholeID of surface casing: 10-inchDiameter of borehole: 10-inchRiser pipe ID: 4-inchType of riser pipe: Sch 40 PVCType of backfill: Cement grout mixDepth to top of seal: 35.6Type of seal: Bentonite chipsDepth to top of sand: 37.6Depth to top of screen: 39.6Type of screen: Sch 40 PVCSlot size & length: 10, 10 ftID of screen: 4-inchType of sandpack: 00 SandDepth of bottom of screen: 49.6Depth to bottom of sump: 50Depth of bottom of borehole: 50Notes: 4-inch sump